

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

RECEIVED BY O. BOX 2088

SANTA FE, NEW MEXICO 87501

APR 8 1986

O. C. D.

ARTESIA, OFFICE

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. Name of Operator PENROC OIL CORPORATION	5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
2. Address of Operator P O DRAWER 831 MIDLAND TX 79702	5. State Oil & Gas Lease No. K-6797
3. Location of Well UNIT LETTER K , 1980 FEET FROM THE South LINE AND 1980 FEET FROM THE West LINE, SECTION 27 TOWNSHIP 20S RANGE 27E NMPM.	7. Unit Agreement Name -----
15. Elevation (Show whether DF, RT, GR, etc.) 3224 GR	8. Farm or Lease Name Allied "B" Comm.
12. County Eddy	9. Well No. 1
10. Field and Pool, or Wildcat Avalon Morrow & Penlor Bone Spring	11. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> OTHER <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> CASING TEST AND CEMENT JOBS <input type="checkbox"/> OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Total Depth: 11,050' PBTD: 10,965' Completed in Morrow 11/22/74 thru perfs: 10,978-990', 10,864-880', 10,705-770' and in the Bone Spring 1/13/75 thru perfs: 6472-6500', 6507, 09, 11, 13, 15, 21, 23 and 25'.

Prep to Plug & Abandon. Work to commence approx 5/1/86.

Propose to:

- Go in hole, set CIBP by wireline @ 10,660'. Dump 35' cement plug on top of CIBP.
- Mix mud to be used between all plugs.
- Set 25 sk. cement plug @ 9750'.
- Set 25 sk. cement plug @ 8550'.
- Set CIBP @ 6450' w/35' cement plug on top.
- Cut 4½" 11.60# N80 casing @ approx. 5700' and pull.
- Set 35 sk. cement plug @ 5800' to 50' above stub end of 4½" csg. Tag plug.
- Set 35 sk. cement plug @ 4300'.
- Set 35 sk. cement plug @ 2475'.
- Set 35 sk. cement plug @ 2215'. Tag plug.
- Set 35 sk. cement plug @ 400'.
- Set 10 sk. cement surface plug.
- Cut off wellhead. Install dry hole marker, remove all surface equipment. Clean and level location and fill any pits.
- Will advise when location ready for final inspection for P&A approval.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u><i>Barling J. Pacey</i></u>	TITLE <u>President</u>	DATE <u>4-7-86</u>
APPROVED BY <u><i>M. Williams</i></u>	TITLE <u>OIL AND GAS INSPECTOR</u>	DATE <u>APR 29 1986</u>
CONDITIONS OF APPROVAL, IF ANY:		