

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

RECEIVED

DEC 23 1991

O. C. D.

WELL API NO. 30-015-21517
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K5035
7. Lease Name or Unit Agreement Name <i>Catchlaw Dr. Ut.</i>
8. Well No. 11
9. Pool name or Wildcat Catchlaw Draw Morrow

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER (Temp. Abandoned)

2. Name of Operator
Hallwood Petroleum, Inc.

3. Address of Operator
P.O. Box 378111, Denver, CO 80237

4. Well Location
Unit Letter L : 330 Feet From The West Line and 1915 Feet From The South Line

Section 36 Township 21S Range 25E NMPM Eddy County
10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3,704' KB, 3,688' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: Temporary Abandonment <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

The subject well was temporarily abandoned in November 1991 as follows:

- 1) Pull out of hole with 337 joints of 2-7/8" tubing.
- 2) Run gauge ring and junk basket on wireline to 10,675'.
- 3) Set CIBP #1 at 10,400' and bail 35' of cement on top of it.
- 4) Set CIBP #2 at 10,100' and bail 35' of cement on top of it.
- 5) Set CIBP #3 at 9,340' and bail 35' of cement on top of it.
- 6) Load casing with 2% KCL water and pressure test 5-1/2" casing from 0-9,305' to 500 psi. Held pressure O.K.

NOTE: All plugs settings and pressure test witnessed by Mike Stubblefield with State of New Mexico - OCD.

12/97

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Kevin E. O'Connell* TITLE Drlg. & Prod. Supervisor DATE 12/23/92
Kevin E. O'Connell
TYPE OR PRINT NAME TELEPHONE NO.

(This space for State Use)

APPROVED BY *[Signature]* TITLE *[Signature]* DATE 12/30/92
CONDITIONS OF APPROVAL, IF ANY: