| A star and the first star and the star of the star and t | |
|--|---|
| | |
| RECEIVED RECEIVED | Form C-183 Supersedes Old |
| DISTRIBUTION | ₹ C-102 and C-103 |
| SANTA FE | Effective 1-1-65 |
| | Sa. Indicate Type of Lease |
| | State X Fee |
| APTERIA | 5. State Oil & Gas Lease No. |
| OPERATOR DE LA COMPANY DE LA C | K5090 & K6598 |
| | |
| SUNDRY NOTICES AND REPORTS ON WELLS | |
| USE "APPLICATION FOR PERMIT" (FORM C-1011 FOR SUCH PROPOSALS.) | 7. Unit Agreement Name |
| OIL GAS WELL OTHER- | |
| 2. Name of Operator | 8, Farm or Lease Name |
| Howard Boatright Co., Inc. | JCW State Com |
| Address of Operator | 9. Well No. |
| P.O. Box 7251 Odessa, Texas 79760 | |
| 4. Location of Weil | 10. Field and Pool, or Wildcat |
| 1980 Prot 660 | Winchester - Morrow |
| UNIT LETTER U . 1900 FEET FROM THE LASE LINE AND UUU FEET F | |
| THE South LINE, SECTION 2 TOWNSHIP 205 RANGE 28E NM | |
| THE LINE, SECTION TOWNSHIP RANGE ADE NM | |
| 11111111111111111111111111111111111111 | 12. County |
| \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\ | Eddy |
| 16. Check Appropriate Box To Indicate Nature of Notice, Report or | |
| · · · · · · · · · · · · · · · · · · · | ENT REPORT OF: |
| | INT REPORT OF: |
| PERFORM REMEDIAL WORK | |
| n de la companya 🗃 de la companya de la companya 🖓 la companya de la companya 🖓 la companya de la comp | ALTERING CASING |
| TEMPORARILY AGARDOR COMMENCE DRILLING OPNS. | PLUG AND ABANDONMENT |
| | · · · · · · · · · · · · · · · · · · · |
| and the second se | |
| OTHER | |
| OTHER | [|
| OTHER | ling estimated date of starting any propos |
| OTHER | |
| OTHER | neezed with 50 eachs |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa | neezed with 50 eachs |
| OTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. | neezed with 50 eachs |
| OTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. | eezed with 50 sacks cks on top of retainer |
| OTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and | eezed with 50 sacks cks on top of retainer |
| OTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1103. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. | eezed with 50 sacks acks on top of retainer taged plug at 7011'. |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) see Rule 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on cement | eezed with 50 sacks acks on top of retainer taged plug at 7011'. |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) see Rule 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. | eezed with 50 sacks acks on top of retainer taged plug at 7011'. |
| other 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| other 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| oTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| oTHER 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| orner 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| OTHER 17. Describe Proposed of Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) SEE RULE 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| other I. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| orners 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, incluse work) set Rule 1930. 18. Set retainer at 9800'. Run tubing string into retainer and sque of cement at 2800' OSE. Unstring from retainer and dumped 5 sate Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on cement 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| orners 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclus work) see mule 1703. 1. Set retainer at 9800'. Run tubing string into retainer and squ of cement at 2800' OSE. Unstring from retainer and dumped 5 sa Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | neezed with 50 sacks taks on top of retainer taged plug at 7011'. nt and taged plug at |
| 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusion work's state rule itos. 1. Set retainer at 9800'. Run tubing string into retainer and squip of cement at 2800' OSE. Unstring from retainer and dumped 5 saw Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | taged with 50 sacks taged plug at 7011'. Int and taged plug at Installed dry hole |
| other 17. Describe Propased or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusiver/y state and pertinent dates in the worky state and end of cement at 2800'. Run tubing string into retainer and dumped 5 sate work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | taged with 50 sacks taged plug at 7011'. Int and taged plug at Installed dry hole |
| ornes 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusion work's state rule into. 1. Set retainer at 9800'. Run tubing string into retainer and squip of cement at 2800' OSE. Unstring from retainer and dumped 5 sate Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | taged with 50 sacks taged plug at 7011'. Int and taged plug at Installed dry hole |
| OTHER | <pre>teezed with 50 sacks taged plug at 7011'. Int and taged plug at Installed dry hole</pre> |
| ornes 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusion work's state rule into. 1. Set retainer at 9800'. Run tubing string into retainer and squip of cement at 2800' OSE. Unstring from retainer and dumped 5 sate Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | neezed with 50 sacks acks on top of retainer taged plug at 7011'. nt and taged plug at |
| orner 17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, inclusion work) site work performed on 8-13-79. 1. Set retainer at 2800' OSE. Unstring from retainer and dumped 5 saw Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | <pre>neezed with 50 sacks icks on top of retainer taged plug at 7011'. int and taged plug at . Installed dry hole</pre> |
| In Describe Proposed or Completed Operations (Clearly state all perinent details, and give perinent dates, incluse work) set mule 1703. 1. Set retainer at 9800'. Run tubing string into retainer and sque of cement at 2800' OSE. Unstring from retainer and dumped 5 saw Work performed on 8-13-79. 2. Cut 4 1/2 casing at 7181' and pulled out hole with casing. 3. Run tubing and spotted a 65 sacks at 7281' waited on cement and 4. Pulled tubing to 4761 and spotted a 35 sacks. 5. Pulled tubing to 2751' and pumped a 50 sack plug waited on ceme 2625 feet. 6. Pulled tubing to 450 ft. and spotted a 35 sack plug. 7. Pulled out hole cut off well head. Placed 10 sack surface plug marker and rigged down. 8-17-79. | <pre>teezed with 50 sacks taged plug at 7011'. Int and taged plug at Installed dry hole</pre> |