

NM-01165

Williamson BC Federal #3

30-015-21628

Und. Bone Springs

Eddy Co., NM

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different lease.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

YATES PETROLEUM CORPORATION

(505) 748-1471

3. Address and Telephone No.

105 South 4th St., Artesia, NM 88210

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL & 660' FEL of Section 17-T20S-R29E (Unit H, SENE)

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
- ☐ Subsequent Report
- ☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
- ☐ Recompletion
- ☐ Plugging Back
- ☐ Casing Repair
- ☐ Altering Casing
- ☐ Other

- ☐ Change of Plans
- ☐ New Construction
- ☐ Non-Routine Fracturing
- ☐ Water Shut-Off
- ☐ Conversion to Injection
- ☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

If recompletion attempt to Bone Springs proves unsuccessful, will plug and abandon well as follows:

1. POOH with tubing, packer and RBP.
2. Set CIBP at 9600' and cap with 35' of cement to isolate Wolfcamp perforations.
3. Set CIBP at 7800' and cap with 35' of cement to abandon Bone Springs perforations.
4. Fill hole with 10 ppg salt gel containing 25#/barrel water.
5. Determine free point of 5-1/2" casing. Cut and pull as much as possible. Temperature Survey indicates top of cement at 5620'.
6. Spot 50 sack cement plug (150' in open hole) across 5-1/2" casing stub. Tag plug.
7. Spot 50 sack cement plug from 3250-3100' to cover intermediate casing shoe at 3175'.
8. Spot 40 sack cement plug from 675-525' across surface casing shoe at 500'.
9. Spot a 25 sack cement plug at surface.
10. Install regulation abandonment marker.

NOTIFY BLM (505-887-6544) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS.

14. I hereby certify that the foregoing is true and correct

Signed

Title Production Clerk

Date Nov. 2, 1994

(This space for)

FORIC: SCD.) JOE G. LARA

Title

PETROLEUM ENGINEER

Date

12/6/94

Approved by

Conditions of approval, if any:

See attached. Also tag plug across 8 5/8" csg shoe.