Form 3160-5 (August 1999)	(****	TED STATES			
(Mugust 1999)	DEPARTI	.T OF THE INTERIO		ist. 2 FORM APPROVED OMB No. 1004-0135 CISI ²	
				10 AVENUE Expires November 30, 2000	
	SUNDRY NOTICES AND REPORTS ON WELLS Artesia, NM Do not use this form for proposals to drill or to re-enter an			NM-26822	
а	bandoned well. Use Form 3160-3 (APD) for such		ch proposals.	6. If Indian, Allottee or Tribe Name N/A	
				7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well	JBMIT IN TRIPLICATE -	Other Instructions on r	everse side	SRM 1290 8. Well Name and No.	
	X Gas Well	Other		BOX CANYON GJ FEDERAL #1	
2. Name of Operator Yates Petroleum C	orporation /			9. API Well No. 30-015-21876	
3a Address		3b. Phone No. (inclu	de area code)	10. Field and Pool, or Exploratory Area	
4. Location of Well (Footage, Se		(505-748-1471	18 Correction	BOX CANYON PERMO PENN	
			Ed April 6	11. County or Parish, State	
2310' FSL & 1650' FE	L Section 13-T	21S-R21E UNIT	J'	EDDY COUNTY, NM	
	ROPRIATE BOX(ES) TO	INDICATE NATURE OF	NOTICE, REPORT, OR OTH		
		——————————————————————————————————————	TYPE OF ACTION		
X Notice of Intent			Production (Start/Resume)	Water Shut-Off	
Subsequent Report	Alter Casing	Fracture Treat		Well Integrity	
Final Abandonment Notice	Casing Repair	New Construction		Other	
	Change Plans	X Plug and Abandon	Temporarily Abandon		
	Convert to Injection	Plug Back	Water Disposal	approximate duration thereof. If the proposal is to deepen	
 MIRU WL to set 5-1/2" the top Wolfcamp perf & c RU WL & free point 5-1 TIH w/ tubing; load hole clean. WOC. Tag plug w/ Spot 50 sk Class C cen Spot 50 sk Class C cen Spot 40 sk Class C cen Spot 15 sk Class C cen Remove all surface equ I hereby certify that the foregoing 	ad, NU BOP. RU safety e CIBP @ 6404', 50' above dump 35' of cement on top /2" casing. Cut casing +/- a w/ plugging mud & spot tubing & reset if necessar nent plug from 3357-3457 nent plug from 1368-1468 nent plug from 1368-1468 nent plug at surface. upment & weld dry hole m	quipment. 5000' of casin the top Canyon perf & d o of CIBP. Load hole as r 5000', or at the free poir 50 sk Class C cement pl y. ', across Abo top. Pull tu ' across surface casing s ' across Glorieta top. Pul	g recovery will be attempted. T ump 35' of cement on top of C necessary w/ plugging mud. nt if above 5000'. Pull casing. ug across 5-1/2" casing stub. F bing up hole & reverse circ tub shoe. Pull tbg. up hole & reverse Il tubing up hole & reverse circ	BP. Set a second CIBP @ 5704', 50' above Pull tubing up hole & reverse circ tubing bing clean. se circ clean. Tag plug & reset if needed.	
Name (Printed Typed) Donna Clack			Title Operations Technics		
Signature	na Clac	2	Date 7-1-02	<i>un</i>	
		THIS SPACE FOR FED	ERAL OR STATE OFFICE US		
Approved by	. SGD.) ALEXIS C. S		Title		
Conditions of approval, if any, are the applicant holds legal or equita applicant to conduct operations th	attached. Approval of this notice ple title to those rights in the subje	does not warrant or certify that	Office	ENGINEER JUL 00 2002	
Title 18U.S.C. Section 1001 and or fraudulent statements or regulation	Title 43 U.S.C. Secolul2, mak	e it a crime for any person know Is jurisdiction.	ingly and willfully to make to any depart	ment or agency of the United States any false, fictitious	
				JBJECT TO QUIREMENTS AND PULATIONS ATTACHED	