

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO REOPEN OR PLUG BACK TO A WELL. IT IS RESERVED FOR USE IN APPLICATION FOR PERMIT TO DRILL OR TO REOPEN OR PLUG BACK TO A WELL.)

DEC 8 1976

5a. Indicate Type of Lease State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name South Lakewood Com.
9. Well No. 1 1-Y
10. Field and Pool, or Wildcat Wildcat, Morrow
17. County Eddy

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- <u>Dry Hole</u>
2. Name of Operator Llano, Inc.
3. Address of Operator P. O. Box 1320, Hobbs, New Mexico 88240
4. Location of Well UNIT LETTER <u>E</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>840</u> FEET FROM THE <u>west</u> LINE, SECTION <u>3</u> TOWNSHIP <u>20-S</u> RANGE <u>26-E</u> NMPM.
15. Elevation (Show whether DE, RT, CR, etc.) 3259 GL

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned as follows:

- 11-2-76 Set 40 sx plug from TD to 10,140'
Set 40 sx plug from 9,400' to 9,500'
Set 40 sx plug from 7,900 to 8,000'
Set 40 sx plug from 7,250' to 7,350'
Set 40 sx plug from 5,500' to 5,600'
Set 40 sx plug from 3,000' to 3,100'
set 40 sx plug from 2,000 to 2,100'
Heavy mud placed between plugs
- 11-5-76 RIH w/tbg & pkr. Acidized open hole interval 1,900' to 2,000' w/2,000 gals BDA acid. Swabbed well. Rec 59 to 55 BWP, no show of oil.
- 11-8-76 POH w/tbg & pkr. set 50 sx cmt plug from 1,850' to 1,950'. Set 50 sx cmt plug from 900' to 1,000'. Set 15 sx cmt plug from 35' to surf. Placed heavy mud between plugs. Installed 4' dry hole marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Manager of Operations
and Construction

SIGNED A. Moody

TITLE

DATE 12-6-76

APPROVED BY [Signature]

TITLE

SUPERVISOR, DISTRICT II

DATE

JAN 2 8 1977

CONDITIONS OF APPROVAL, IF ANY: