

**State CW #1  
Workover Procedures**

1. MIRU rig. Kill well. ND WH. Release Baker Loc Set pkr at 10,540' and POOH w/tbg.
2. RU WL. PU 5-1/2", 17# CIBP and TIH. Set CIBP at 10,575'. Dump bail 35' of cmt on top of CIBP.
3. RIH Tag plug circulate hole full of 10# salt gel.
4. Cut and pull 5.5 casing from 8,000'.
5. Spot stub plug from 8,050' to 7,950'.
6. Tag stub plug and spot plug from 4,650' to 4,550'.
7. Spot shoe plug across 8-5/8 shoe from 3,110' to 2,910'.
8. Spot shoe plug across 13-3/8 shoe from 650' to 550'.
9. Tag shoe plug and spot 50' surface plug 10' BGL.
10. Cut casing and remove WH. Weld on cap and install marker.
11. Reclaim surface equipment and re-seed location.