

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-21912
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator ROCA Production, Inc.		6. State Oil & Gas Lease No. LG-12 & K6775
3. Address of Operator P.O. Box 11148, Midland, Texas 79702		7. Lease Name or Unit Agreement Name: Mesa Macho Com
4. Well Location Unit Letter _____: 1,980 feet from the North line and 1,980 feet from the East line Section 24 Township 20-S Range 27E NMPM Eddy County		8. Well No. 2
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3,350' GR; 3,366' KB		9. Pool name or Wildcat Burton Flat (Morrow)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- 5/30/01 MI plugging equipment to location. Notified OCD, Jerry Guy.
6/01/01 Notified OCD, Jerry Guy. Set CIBP @ 10,800'. Circulated hole w/ mud and pumped 25 sx C cmt 10,800 - 10,553'. POOH w/ tbg and SD for weekend.
6/5/01 Notified OCD, Phil Hawkins. Cut casing @ 8,512' and start OOH w/ csg.
6/6/01 Finished POOH w/ casing, talley 8,542.90'. Start in hole w/ tubing, SDFN.
6/7/01 Notified OCD, Phil Hawkins. Loaded hole w/ mud and pumped 45 sx C cmt @ 8,573'. WOC and tagged cmt @ 8,439'. Pumped 45 sx C cmt 6,200 - 6,024'. Pumped 45 sx C cmt @ 4,700'. POOH w/ 30 stands and SDFN.
6/8/01 Notified OCD, Phil Hawkins. Tagged cmt @ 4,587'. Pumped 60 cmt w/ 3% CaCl₂ @ 2,650'. WOC and tagged cmt @ 2,485'. Pumped 45 sx C cmt @ 710'. SD for weekend.
6/11/01 Notified OCD, Jerry Guye. Tagged cmt @ 585'. Pumped 20 sx C cmt 50' to surface.
7/18/01 Cut off wellhead and installed dryhole marker, cut off anchors and leveled pit and cellar.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE **President** DATE **7/9/01**

Type or print name **James F. Newman, P.E. - Triple N Services, Inc.** Telephone No. **915-687-1994**
(This space for State use)

APPROVED BY  TITLE **J. L. Sep** DATE **JAN 24 2002**

Conditions of approval, if any: