## Submit 3 Copies to Appropriate District Office

DISTRICT I

## State of New Mexico E. gy, Minerals and Natural Resources Departme.

.~	104
Form C-103	(> T
Revised 1-1-89	110
	VIZ

DISTRIC	II		
P.O. Box	1980, Hot	MN ,ade	88240

1000 Rio Brazos Rd., Aztec, NM 87410

P.O. Drawer DD, Artesia, NM 88210

## OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DEC 3 0 1993

30-015 · ZI9ZD  5. Indicate Type of Lease  STATE X FE	
5. Indicate Type of Lease	
SIAIE ZX FE.	

6. State Oil & Gas Lease No. VA 834 SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) LONE TREE 1. Type of Well: OIL WELL OTHER 2. Name of Operator 8. Well No. CHI OPERATING, INC. 3. Address of Operator 9. Pool name or Wildcat P.O. Box 1799; MIDLAND, Tx. 79702 4. Well Location 1980 Feet From The 1980 Feet From The \_\_ WEST Line and 13 EDDY 21-5 27-E Section Township Range **NMPM** 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Theck Appropriate Roy to Indicate Nature of Notice

11.	meek tipt	Nopilia Dox to Hid	icau i	valuic of Profice, Report, of	Cuici Dala	
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:				
PERFORM REMEDIAL WORK		PLUG AND ABANDON		REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON		CHANGE PLANS		COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT	
PULL OR ALTER CASING				CASING TEST AND CEMENT JO	в	
OTHER:				OTHER: COMPLETION OF	PE-ENTRY	X
				<del></del>		

- 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
- 1) MOVED IN COLLUCTION WIT ON 11/2/93. DRESS OFF \$ 51/2" CASING SLIP JOINT (AS DESCRIBED IN SUNDRY NOTICE DATED 11/1/43). TEST TIE-BACK TO 1000 PSI, OK.
- 2) DRILL CUT AND CIBP AT 7297', PUSH CIBP TO BOZO'.
- 3) SHOOT SOZ HOLES AT 7970'& 7520' PERFORM BLOCK SOZ WITH RINK AT 7581'. PUMP 147 SXS CL. C" CUT.
- 4) Dell out RINE & CMT TO 7900 W7 434" BIT.
- 5) PERFORATE BONE SIRING FROM 1558-7770 W7 34 HOLES.
- 6) ACIDIZE W ZOOD GALS 15% NEFE ACID. FRAC WY 84,500 GALS X-LINE GEL & 252,870 & 616/30 SAND.
- 7) FLOW BACK LOAD.

DATE 12/6/93
TELEPHONE NO. (915) 685-500
DEC 3 0 1993
DATE