

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.O.S.	
LAND OFFICE	
OPERATOR	

NOV 22 '88

WATER OFFICE

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.
COM. NO. SCR-186

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO OPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
Bass Enterprises Production Co.

3. Address of Operator
P O Box 2760 Midland Texas 79702-2760

4. Location of Well
UNIT LETTER C 1980 FEET FROM THE FWL LINE AND 660' FEET FROM THE FNL LINE, SECTION 31 TOWNSHIP 21S RANGE 28E NMPM.

7. Unit Agreement Name
Big Eddy Unit

8. Farm or Lease Name
Big Eddy Unit

9. Well No.
65

10. Field and Pool, or Wildcat
Carlsbad Strawn East

12. County
Eddy

15. Elevation (Show whether DF, RT, GR, etc.)

3131.4' GL 3149' KB

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TO PLUG AND ABANDON UPON APPROVAL

1. Move in. PU install 5000 Psi BOPE Release packer & POOH w/tubing
 2. RIH w/Baker "T" CIBP Set @ 10,370' CIRC w/10ppg Mud Laden fluid Cement w/25sx Class "H" Neat Cement
 3. Set plug @ 9,187' - 9,139' w/25 sx Class "H" Neat Cement
 4. RIH w/G.O. Freepoint Tool & Casing Jet Cutter & Cut Casing @ 7500'
 5. POOH w/Csg.
 6. RIH to 7,575' & Cement w/35 sx Class "H" Neat Cement across csg. stub
 7. RIH and Tag Cement
 8. Set plug @ 5749' w/50 sx Class "H" Neat Cement across T/Bone Spring
 9. Set plug @ 2965' w/ 50 sx Class "H" Neat Cement across 8 5/8" shoe Tag*
 10. Set plug @ 548' w/36 sx Class "H" Neat Cement across 11 3/4" shoe
 11. Set plug @ 50' w/16 sx Class "H" Neat Cement to surface.
 12. Set dry hole marker, and clean up around location
- * 25sx Plug @ 1240-1140 DV Tool 1190

NOV 22 '88

Plugging

I, [Signature], hereby certify that the information above is true and complete to the best of my knowledge and belief.

signed [Signature] TITLE Sr. Production Clerk DATE 11/21/88

note as above

APPROVED BY [Signature] TITLE OIL AND GAS ENGINEER DATE DEC 06 1988