

Form 3160-5
(June 1990)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT *to*

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
SOUTHWEST ROYALTIES, INC.

3. Address and Telephone No.
P.O. BOX 11390, MIDLAND, TX 79702 (915) 686-9927 ext 307

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
SEC. 34, T-20S, R-26E
960' FSL AND 1980' FWL

5. Lease Designation and Serial No.

NM34458

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

FEDERAL 34 #1

9. API Well No.

30-015-22738

10. Field and Pool, or Exploratory Area

SPRINGS UPPER PENN

11. County or Parish, State

EDDY COUNTY, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other
☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PROPOSED PROCEDURE TO PLUG AND ABANDON

- 1) RIL WITH WORK STRING TO 7660' AND CIRCULATE 9.0 PPG MUD WITH GEL AS REQUIRED. POH.
- 2) CUT 7" CASING AT 4400' AND RECOVER 7" CASING.
- 3) RIL WITH WORK STRING TO 4530'. SPOT 60 SX CLASS C PLUG FROM 4530'-4300'. WOC TAG PLUG WITH WORK STRING.
- 4) SET 200' PLUG ACROSS BASE OF 9 5/8" FROM 2720'-2920' (20 SX CLASS C). WOC. TAG PLUG WITH WORK STRING.
- 5) SET 100' PLUG ACROSS BASE OF 16" FROM 225'-325' (20 SX CLASS C)
- 6) SET 50' SURFACE PLUG (20 SX CLASS C)
- 7) INSTALL CAP AND MARK AS PER BLM REQUIREMENTS

WILL NOTIFY BLM (505) 887-6544 48 HOURS BEFORE BEGINNING OPERATIONS.

14. I hereby certify that the foregoing is true and correct

Signed *[Signature]*

Title REGULATORY ASST.

Date 4-25-95

(This space for signature of the operator)

FORG. SEC. JOE G. LARA

PETROLEUM ENGINEER

Approved by
Conditions of approval, if any:

Title

Date

5/1/95

See attached.