

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

NM OIL CONS COMMISSION
Drawer DD

Artesian Form NM 88210
BUDGET APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT 6

RECEIVED

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

SOUTHWEST ROYALTIES, INC.

3. Address and Telephone No.

P.O. BOX 11390, MIDLAND, TEXAS 79702 (915) 688-9927

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SEC. 34, T-20S, R-26E
960' FSL and 1980' FWL

5. Lease Designation and Serial No.
NM34458

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

FEDERAL 34 #1

9. API Well No.

30-015-22738

10. Field and Pool, or Exploratory Area

SPRINGS UPPER PENN

11. County or Parish, State

EDDY COUNTY, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
<input checked="" type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Other	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

PROPOSED PROCEDURE TO PLUG AND ABANDON

- 1) RIE WITH WORK STRING TO 7660' AND CIRCULATE 9.0 PPG MUD WITH GEL AS REQUIRED. POH.
- 2) CUT 7" CASING AT 4400' AND RECOVER 7" CASING.
- 3) RIE WITH WORK STRING TO 4530'. SPOT 60 SX CLASS C PLUG FROM 4530'-4300'. WOC. TAG PLUG WITH WORK STRING.
- 4) SET 200' PLUG ACROSS BASE OF 9-5/8" FROM 2720' - 2929' (20 SX CLASS C). WOC. TAG PLUG WITH WORK STRING.
- 5) SET 100' PLUG ACROSS BASE OF 16" FROM 225' - 325' (35 SX CLASS C).
- 6) SET 50' SURFACE PLUG (20 SX CLASS C)
- 7) INSTALL CAP AND MARK AS PER BLM REQUIREMENTS.

WILL NOTIFY BLM (505) 887-6544 48 HOURS BEFORE BEGINNING OPERATIONS.

14. I hereby certify that the foregoing is true and correct

Signed Shannon J. Shaw

Title AREA SUPERVISOR

Date 8-23-95

(This space for Federal or State office use)

Signed by Shannon J. Shaw

PETROLEUM ENGINEER

Approved by _____
Conditions of approval, if any:

Title _____

Date 9/21/95