

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87501

MAY 20 1991

O. C. D.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-22938
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> RE-ENTRY P&A		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator YATES PETROLEUM CORPORATION		6. State Oil & Gas Lease No. V-1798
3. Address of Operator 105 South 4th St., Artesia, NM 88210		7. Lease Name or Unit Agreement Name South Soapberry AIH State
4. Well Location Unit Letter <u>M</u> : <u>660</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>18</u> Township <u>21S</u> Range <u>26E</u> NMPM Eddy County		8. Well No. 1
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3311' GR		9. Pool name or Wildcat Undes. Carlsbad Delaware

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows: Unset packer and RBP, POOH. TOH w/2-7/8" tubing. TIH w/jet cutter and cut off 5-1/2" casing at 1350'. TOH and laydown casing. TIH w/tubing to 4000'. RU and circulate hole w/10# brine w/20# bbls salt water gel. Mix and set 25 sx C Neat plug from 4008-3768'. Laydown 26 jts 2-7/8" tubing. Mix and set 25 sx C Neat plug from 3181-2941'. Lay down 15 jts 2-7/8" tubing. Mix and set 25 sx Class C + 2% CaCl2 plug from 2704-2448'. Pull 10 stands and WOC 2 hrs. RIH and tag plug at 2448'. Lay down 41 jts 2-7/8" tubing. Mix and set 25 sx C Neat plug from 1400-1260'. Lay down 26 jts 2-7/8" tubing. Mix and set 25 sx C Neat plug from 573-383'. Lay down 17 jts 2-7/8" tubing. Mix and set 10 sx C Neat plug at surface. Lay down 1 jt 2-7/8" tubing. Install dry hole marker. Plugging completed 5-15-91.

Plugging witnessed by Mike Stubblefield, NMOCD, Artesia, NM.

Part IP-2
7-26-91
p4 A

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 5-16-91

TYPE OR PRINT NAME Juanita Goodlett

TELEPHONE NO. 505/748-147

(This space for State Use)

ORIGINAL SIGNED BY
MIKE WILLIAMS
SUPERVISOR, DISTRICT IV

APPROVED BY _____ TITLE _____ DATE MAY 22 1991

CONDITIONS OF APPROVAL, IF ANY: