

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN 3  
(Other instructions  
on reverse side)ICATE\*  
on re-Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM-34560 34650

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Indian Wells

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Sec. 19-T22S-R25E

12. COUNTY OR PARISH

Eddy

13. STATE

NM

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐ FEB 09 1983

2. NAME OF OPERATOR MORRIS R. ANTWEIL ✓ O. C. D.

3. ADDRESS OF OPERATOR P. O. Box 2010 Hobbs, New Mexico 88240 ARTESIA OFFICE

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface  
2080' FSL & 1980' FEL  
Sec. 19-T22S-R25E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
3736' GR

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON\* ☐CHANGE PLANS ☐

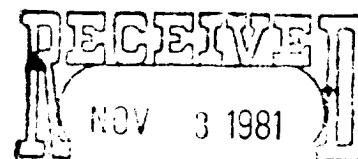
## SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT\* ☒(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

- 1) Ran tubing to 9700' and spotted 40 sk plug 9700'-9250'
- 2) Spotted 65 sk plug 7860'-7500' across 4 1/2" liner hanger.
- 3) Took stretch test. Indicated 7000' free pipe.
- 4) Shot pipe at 7000'. Pulled 18 joints casing.
- 5) Dumped 4 yards gravel on 7" casing stub. Tagged gravel at 6940'. Pulled casing.
- 6) Ran tubing to 6950' and spotted 100 sk plug. WOC 12 hours and tag plug at 6900'.
- 7) Spotted plugs as follows:

40 sk 3650'-3750'  
35 sk 2550'-2650'  
35 sk 530'-630'  
15 sk Surface plug with marker

OIL & GAS  
U.S. GEOLOGICAL SURVEY  
ROSWELL, NEW MEXICO

PLUGGED AND ABANDONED 31 OCT 81

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Agent

DATE 2 Nov 81

(This space for Federal use only)

APPROVED BY: S. J. PETER W. CHESTER  
CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

FEB 8 1983

FOR

JAMES A. GILLHAM \*See Instructions on Reverse Side  
DISTRICT SUPERVISOR