			—ı						
N. OF 20	PIES RECEIVED						Form C-103		
DISTE	RIBUTION				RECEIVED		Supersedes C-102 and t		
SANTA FI	E <del></del>		NEW M	IEXICO OIL CONS	ERVATION COMMISSION	:	Effective 1		
FILE		+1-			MANA 1 0 1000	•			
U.S.G. <b>S.</b>					MAY 1 3 1982	:	5a. Indicate Ty	·	
LAND OF							State X	Fee	
OPERATO	DR				O. C. D.		5. State Off & C L - 51		
		<b></b>			ARTESIA, OFFICE			23 	
(00)	NOT USE THIS F	SUN FOR	IDRY NOTICES ANI	D REPORTS ON	WELLS BACK TO A DIFFERENT RESERVOIR H PROPOSALS.)	•			
1.	0.51	APPLI	CATION FOR PERMIT _** (	FORM C-101) FOR SUC	H PROPOSALS.)		7. Unit Agreem	ent Name	
OIL WELL	GA5	X	OTHER-					ent rume	
2. Name of Operator							8. Farm or Lease Name		
Mewborne Oil Company							Marathon - State		
3. Address of Operator							9. Well No.		
P. (	). Box 769	8 T	Tyler, Texas 75	711			1		
4. Location					· · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·	10. Field and F	Pool, or Wildcat	
UNIT LE	АА		660 FEET FRO	North	1315	FEET FROM	Wilde	at wolfcom.	
ТНЕ	East	LINE, SE	30	TOWNSHIP	RANGE 27 E	NMPM.			
IIIII.	<u>IIIIIII</u>	$\overline{IIII}$	15. Eleve	ation (Show whether 3221 GR	DF, RT, GR, etc.)		12. County	iiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiii	
16.		$\overline{\overline{}}$	7111111				Eddy		
	ΝΟΤΙ		k Appropriate Bo F INTENTION TO:	x To Indicate N	lature of Notice, Repoi SUBS		n <mark>er</mark> Data TREPORT OF	F:	
	ſ	-				r		( <b></b> -)	
	MEDIAL WORK	4	PLU	IG AND ABANDON	REMEDIAL WORK		ALT	ERING CASING	
TEMPORARIL		4		[]	COMMENCE DRILLING OPNS.		PLUG	AND ABANDONMENT	
PULL OR ALT	TER CASING		СНА	NGE PLANS	CASING TEST AND CEMENT JQ8			<b>ل</b> ــــا	
OTHER					OTHER				
VIALA		·····							
17. Describe	Proposed or Co EE RULE 1103.	ompleted	i Operations (Clearly st	ate all pertinent deta	ails, and give pertinent dates,	including	estimated date o	f starting any proposed	
<i>wonty</i> 5	LE NOLE 1103.								
1.	4-30-82	Set	C.I.B.P. at 7	880' and cap	it with 25 sacks	of cem	ent.		
2.									
	<b>F</b> 0 00				with 10# salt gel				
3.	5-3-82	and	Spotted a 35 sack plug in and out of $4\frac{1}{2}$ " casing stub at 5994'. W.O.C. and tagged at 5820'.						
4.	5-3-82	P.U	P.U.H. with tubing 5562' and spot a 35 sack plug.						
5.	5-3-82	P.U	P.U.H. with tubing to 3059' and spot a 35 sack plug.						
6.	5-3-82	P.U 180	P.U.H. with tubing 2008' and spot a 35 sack plug. W.O.C. Tagged at 1802' across 8 5/8 shoe.						
7.	5-4-82	P.U.	P.U.H. to 556' and spot a 35 sack plug. P.O.H.						
8.	8. Cut off well head and place a 10 sack surface plug and dry hole marker.								
18. I hereby	certify that the	informat	tion above is true and co	omplete to the best of	of my knowledge and belief.				
1	$\int $	~							
SIGNED A	lelin	) I	reard	TITLEProd	uction Clerk		DATE	5-6-82	
								u <u>o 66-05</u>	
1000 OVED	Trebel	Aule-	blick	01	L AND GAS INSPECT	<b>'O</b> F	JL	JL - 2 1902	
REAVED BY			<u>19-042 -</u>			<u>-67 3'5</u>	UAIC		
CONDITION	S OF APPROVA	L, IF A	IN T I						