

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form O-103
Revised 10-1-75

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	☒
OPERATOR	☒

SEP 14 87

O. D.
ARTIC 10

5a. Indicate Type of Lease State ☒ Fee ☐
5. State Oil & Gas Lease No. 74-1-1
7. Unit Agreement Name
8. Farm or Lease Name State
9. Well No. 1
10. Field and Pool, or Willcut Undesignated Atoka
11. County Eddy

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
SEE APPLICATION FOR PERMIT WITH FORM O-101 FOR SUCH PROPOSALS.

OIL WELL ☐ GAS WELL ☒ OTHER ☐

DATE OF NOTICE

Pogo Producing Company

P. O. Box 10340, Midland, Texas 79702

UNIT CENTER M 3300 FEET FROM THE South LINE AND 660 FEET FROM

THE West ONE SECTION 2 TOWNSHIP 21-S RANGE 28-E

1. Elevation (Show whether Dr., RT, GR, etc.)

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☒ OTHER ☐

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

See attached sheet.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Division Operations Manager DATE 9/11/87

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

AS NOTED ON ATTACHED SHEET

SEP 21 1987

PLUG AND ABANDONMENT
STATE NO. 1
3300' FNL & 660' FWL
SECTION 2, T-21-S, R-28-E
EDDY COUNTY, NEW MEXICO

1. Notify NMOCD at Artesia prior to setting plugs.
2. RIH tubing to 9200'. Fill hole w/Brine water and circulate gel.
3. Spot following cement plugs:
 - 100 feet, 9200' to 9100'
 - 100 feet, 7200' to 7100'
 - 100 feet, 5200' to 5100'
4. Cut 5 1/2" 17# S-95 casing at 4730' & recover casing.
Reference McCullough CBL dated 9/1/87.
5. Spot 100' cement plug 50' below & 50' above casing stub. (4780 to 4680'
assuming casing free at 4730') *TAG PLUG*
6. Spot 100' cement plug @ 3300' to 3200' (50' above & 50' below 8 5/8"
casing shoe). *TAG PLUG*
7. Spot 35 sxs cement at surface.
8. Weld on plate. Install P & A marker.

Procedure approved by Lester Clements 9/11/87.