

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Artesia, NM 88210

RECEIVED IN THE
(Other instruct
(Reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

457

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ P&A'd

2. NAME OF OPERATOR

Southland Royalty Company

3. ADDRESS OF OPERATOR

21 Desta Drive, Midland, Texas 79705

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

660' FNL & 2130' FEL, Sec. 5, T-20-S, R-28-E

RECEIVED

MAY 11 1987

O. C. D.

ARTESIA, OFFICE

5. LEASE DESIGNATION AND SERIAL NO

NM 0557562

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Citgo "5" Fed Com

9. WELL NO.

1

10. FIELD AND POOL OR WILDCAT

Undesignated (Wolfcamp)

11. SEC., T., S., M., OR BLK. AND
SURVEY OR AREA

Sec. 5, T-20-S, R-28-E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3329' GR

12. COUNTY OR PARISH

Eddy

13. STATE

N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MIRU PBCP. Instl BOP. POH w/tbg, 4 1/2" on/off tool, pkr & vann guns. RIH & set CIBP @ 9000'. RIH w/tbg. Tag CIBP.
2. Capped CIBP w/20 sxs cmt. Pulled to 8790' & circ hole w/10# brine gel. POH w/tbg. Remove tbg spool. Weld on pull nipple, free pt & shoot off 4 1/2" csg @ 5500'.
3. RIH w/tbg. Circ hole w/10# mud. Spot 45 sxs cmt @ 5575'. POH.
4. RIH w/tbg. Tag plug @ 5300'. POH w/tbg to 3925'. Spot 52 sxs cmt plug across Bone Spring. POH w/tbg to 2650'. Spot 52 sxs cmt plug across 8 5/8" shoe. WOC 4 hrs. RIH w/tbg. Tag plug @ 2480'. Pull tbg to 660'. Spot 27 sxs across salt zone. Pull tbg to 375'. Spot 27 sxs cmt plug across 11 3/4" shoe. POH w/tbg.
5. Well plugged and abandoned 11-1-85. Spotted 15 sx cmt plug from 50' to surf. Clean out head & weld on plate & dry hole marker. RDPU.

Post FD-2
11-22-85
P+H

18. I hereby certify that the foregoing is true and correct

SIGNED Danell Roberts

TITLE Operations Engineer

DATE 11/7/85

(This space for Federal or State office use)

APPROVED BY Arthur J. [unclear]

TITLE [unclear]

DATE 5-5-87

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side