

CITIES SERVICE OIL AND GAS CORPORATION #2 GOVERNMENT Y (RECOMPLETION) CONTINUED....

- 50/50 Pozmix A cement. ND BOP. Set slips & cut off casing. NU WH. ND BOP.
5. RIH w/tubing and CO to 6250'. POOH. Perforate the Bone Springs w/4 SPF @ 6113, 17, 28, 34, 38, 42, 44, 51, 55, 62, 67, 76, 83, 85, 87, 89, 95 and 6197'. RIH w/tubing and set a RTTS @ 5975'. Swab well in and test natural and if necessary acidize the Bone Springs Perfs 6113 - 6197' w/5000 gals 7-1/2% HCL acid. Recover load and treatment and retest well. Kill well, if necessary, release RTTS and POOH.
  6. RIH w/RBP on tubing and set RBP @ 6000', dump 2 sacks of sand on top of RBP and POOH.
  7. Perforate the Bone Springs w/2 SPF @ 5715, 18, 29, 34, 39, 44, 48, 55, 72, 76, 79, 81, 84, 87, 91, 99, 5801, 06, 17, 66, 71, 74, 77, 80 and 5883'. RIH w/tubing and set a RTTS @ 5600'. Swab well in and test well natural and if necessary acidize the Bone Springs Perfs 5715 - 5883' w/5000 gals 15% HCL acid. Recover load and treatment and retest well. Kill well, if necessary, release RTTS and RIH to RBP. Latch on to RBP, release and POOH.
  8. RIH w/tubing and packer or tubing, rods and pump as required. Install pumping equipment and put well on production.