

Recommended Drilling & Completion Procedure  
A.F.E. No. 439  
David Fasken -Maralo Federal No. 1  
Avalon (Morrow) Field  
Eddy County, New Mexico

14. Rig down and move out rotary tools.
15. Set mast anchors and move in pulling unit.
16. Pressure test casing and Christmas tree to 4500 psig.
17. Run 2-3/8" tubing N-80, EUE 8RD c/w AB modified couplings, and packer.
18. Displace fluid in well with 3% KCl water containing oxygen scavenger and corrosion inhibitor.
19. Set packer and install Christmas tree.
20. Swab fluid level to 9000' in tubing.
21. Run Gamma Ray correlation log and perforate Morrow for production.
22. Test well.
23. Stimulate as needed - acid and/or frac.
24. Clean up "load fluid" and test.
25. Run C.A.O.F.P. and pressure build up.
26. Install surface equipment.