


STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	
OPERATOR	☒

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

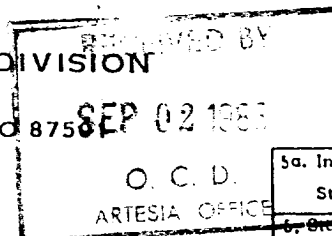

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease	State ☒ Fee ☐
6. State Oil & Gas Lease No.	K-6203

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐	GAS WELL ☒	OTHER ☐	7. Unit Agreement Name
Name of Operator TXO Production Corp. ✓			8. Farm or Lease Name Cal-Mon State Com.
Address of Operator 900 Wilco Building; Midland, TX 79701			9. Well No. 1
Location of Well UNIT LETTER <u>P</u> <u>990</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>7</u> TOWNSHIP <u>21S</u> RANGE <u>26E</u> NMPM.			10. Field and Pool, or Wildcat Undesignated Avalon Morrow Gas
15. Elevation (Show whether DF, RT, GR, etc.) 3240.5 GR			12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Load hole w/ 9# brine str. Inst BOP.
2. Set CIBP w/ 35' cmt @ 10,500', (10 sx). Tag.
3. Set 100' cmt plug from 10,250'-10,150', (10 sx). 25sx
4. Set 100' cmt plug from 9100-9200', (10 sx).
8420-8520 25sx
5. Set 100' cmt plug from 7550-7650', (10 sx). 25sx
6. Free pt., cut and pull 4 1/2" csg.
7. Set 100' cmt plug 50' in and out of stub. (25 sx). Tag.
8. Set 100' cmt plug from 5600-5700', (35 sx).
9. Set 100' cmt plug from 3850-3950', (35 sx).
10. Set 100' cmt plug from 2300-2200', (50 sx). Tag
11. Set 100' cmt plug from 470-570', (75 sx).
12. Set 10 sx at surf.
13. Set marker. Fill pits. Clean location.

16. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Deen Wood TITLE Production Engineer DATE 8/31/83

APPROVED BY Leslie A. Clements TITLE Supervisor District II DATE SEP 29 1983

CONDITIONS OF APPROVAL, IF ANY: