

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	☒
LAND OFFICE	☒
OPERATOR	☒

OIL CONSERVATION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87004

0+6-NMOCD-Artesia
1-File
1-Engr. PJB
1-Foreman

RECEIVED BY
DEC 04 1984
1-Mr. J. Browning
1-JA O. C. D.
1-BB ARTESIA, OFFICE

Form C-103
Revised 11-1-

6. Indicate Type of Lease
State ☒ Fee ☐
7. State Oil & Gas Lease No.
V-993 & V-992

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	7. Unit Agreement Name
2. Name of Operator Getty Oil Company	8. Farm or Lease Name Getty "IB" 32 State
3. Address of Operator P.O. Box 730, Hobbs, N.M. 88240	9. Well No. 1
4. Location of Well UNIT LETTER L 1320 South 660 FEET FROM THE LINE AND FEET FROM West 32 21S 24E THE LINE, SECTION TOWNSHIP RANGE NMPL.	10. Field and Pool, or Wildcat Indian Basin U/Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4295' GR	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

- GIH with drill pipe.
- Spot 100 sx. of Cal-Seal on top of fish at 701'.
- WOC 3 hrs.
- Tag plug.
- If plug has not held, spot another 100 sx. of Cal-Seal.
- WOC 3 hrs.
- Tag plug.
- If plug has not held, spot 1 yard of pea gravel in hole to attempt to obtain a solid plug.
- Fill the hole with water to see if the hole will hold water. If not, spot 100 sx. Cal-Seal, WOC, and repeat to see if hole will hold fluid. If not, spot 1-2 yards of pea gravel. Repeat until hole will hold fluid.
- When hole will hold fluid, begin to set cement plugs.
- Spot 50 sx. cement plug. Pull up and WOC.
- Spot 50 sx. cement plug. Pull up and WOC. Repeat until hole is full of cement.
- Weld 1" steel plate on surface casing.
- Install dry hole marker.
- P & A well.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Robert J. Paradise for TITLE Area Superintendent DATE December 3, 1984

APPROVED BY Leslie A. Clements Original Signed By
Supervisor District II

CONDITIONS OF APPROVAL, IF ANY:

DEC 19 1984