

13. 8th plug - spot 100 sxs. 50/50 plug of calseal and cement @ 380'. WOC 4 hours. Tag @ 379'.
14. Dump LCM in hole and 16 yds ready mix. WOC 4 hours. Tag @ 377'.
15. Ran CIBP on wireline to 300'.
16. Cut off wellhead.
17. TIH. Cement from 300' to surface w/ 100 sxs. 50/50 plug of calseal and cement and 125 sxs. class "H" cement.
18. Completed P&A 10:00 P.M. 12-3-84.
19. Released rig.