

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	
LAND OFFICE	☒
OPERATOR	☒

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED

OCT 31 '88

O.C.C.
ARTESIA OFFICE

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State ☐	Fed ☒
5. State C. & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		7. Unit Agreement Name
2. Name of Operator OXY USA Inc. ✓		8. Farm or Lease Name Tracy F
3. Address of Operator P.O. Box 50250 - Midland, Texas 79710		9. Well No. 1
4. Location of Well UNIT LETTER 0 660 FEET FROM THE South LINE AND 1980 FEET FROM THE East LINE, SECTION 8 TOWNSHIP 20S RANGE 28E NMPM.		10. Field and Pool, or Wildcat Wildcat Bone Springs
15. Elevation (Show whether DF, RT, GR, etc.) 3276.8' GR		12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

T.D. 4804' Lime & Shale, PBD 4065'. It is proposed to plug and abandon this well in the following manner:

1. MIRU a pulling unit, ND WH, NU BOP's and POOH w/1 joint of tubing.
2. RIH w/2-3/8" OD'd tubing to 4000' and pressure test the 5-1/2" casing to 1000# and load the hole w/9.5 ppg mud laden fluid. POOH w/tubing to 2250'.
3. Spot a ²⁵ sack Class C cement plug @ 2250 - 2144', 1/2 in and 1/2 out of the 8-5/8" casing shoe @ 2198'. Displace plug w/mud laden fluid. POOH w/tubing to 520'.
4. Spot a ²⁵ sack Class C cement plug @ 520 - 414', 1/2 in and 1/2 out of the 13-3/8" casing shoe @ 468'. Displace plug w/mud laden fluid and POOH w/tubing.
5. Cut off the WH and casing below the GL and spot a 5 sack Class C surface plug @ 48' - surface and install a dry hole marker to designate a plugged and abandoned location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mike Williams TITLE Dist. Opr. Mgr. - Prod. DATE 10-28-88

Original Signed By
Mike Williams

PROVED BY Mike Williams TITLE Dist. Opr. Mgr. - Prod. DATE NOV 04 1988

CONDITIONS OF APPROVAL, IF ANY: * As Noted Above

Notify N.M.O.C.C. in sufficient time to witness

Plugging