

Procedure for Reentry of Eddy "IK" State #1
to test Seven Rivers Formation

1. Cut off dry hole marker and weld on wellhead. Put on BOP. Test BOP.

2. Rig up reverse unit and pulling unit. GIH w/ 7 7/8" blade bit and 6 drill collars. Drill out plugs as follows:

	TOC	BOC	
1)	Surface	30'	10 SKS.
2)	386'	500'	30 SKS. Tagged
3)	1078'	1215'	35 SKS. Tagged

Circulate hole clear and test casing to 1500#.

3. POOH w/tubing, drill collars and bit.

4. GIH and perforate the following 1488'-1494', 1526'-1530'.

5. GIH w/tubing and packer and acidize w/500 gallons of NEFE acid.