

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

10/29/90

WELL API NO.	30-015-26442
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Simpson A
8. Well No.	2
9. Pool name or Wildcat	Burton Flat Morrow
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	3136.4' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	2. Name of Operator OXY USA Inc. ✓
3. Address of Operator P.O. Box 50250	4. Well Location Unit Letter J : 1980 Feet From The South Line and 1980 Feet From The East Line Section 29 Township 21S Range 27E NMPM Eddy County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3136.4' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: Plug hole - Skid rig ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Drill to a TD of 1640', having hole problems. POOH, LD BHA. RIH w/ open-ended DP to 1300'. Spot 100sx Cl C w/ 4% CaCl₂, POOH WOC 2hrs, RIH to 1300', no fill. Spot 100sx Cl C w/ 4% CaCl₂, POOH WOC 2hrs, RIH tag TOC @ 1250'. Spot 200sx Cl C Prem + thickset, POOH WOC 2hrs, RIH tag TOC @ 1180'. POOH to 550'. Spot 100sx Cl C w/ 4% CaCl₂, POOH WOC 2hrs, RIH tag no cement. Spot 100sx Cl C w/ 4% CaCl₂ + 5sx LCM ahead of cement, POOH WOC 2hrs, RIH tag TOC @ 1090'. Spot 100sx Cl C w/ 4% CaCl₂ + 5sx LCM ahead of cement, POOH WOC 2hrs, RIH tag TOC @ 980'. Dump 8 yds pea gravel, tag @ 825'. RIH to 560', spot 20sx Cl C w/ 4% CaCl₂, POOH WOC 2hrs. Put 65sx mud down 13-3/8" casing, RIH to 560', spot 100sx Cl C w/ 4% CaCl₂. POOH WOC 2hrs, RIH tag @ 530'. Had total circulation during last plug w/ no fall back. All plugs witnessed & approved by NMOCD Mike Stubblefield & Darrell Moore. Rel rig @ 1500hrs CDT 10/5/90. Spot 10sx Cl C from 50' to surface. Skid rig to Simpson A #2Y.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE F.A. Vitrano TITLE Region Operations Manager DATE 10/25/90
TYPE OR PRINT NAME F.A. Vitrano (Prepared by David Stewart) TELEPHONE NO. 9156855717

(This space for State Use)

ORIGINAL SIGNED BY
MIKE WILLIAMS
SUPERVISOR, DISTRICT II

APPROVED BY _____ TITLE _____ DATE NOV 16 1990

CONDITIONS OF APPROVAL, IF ANY: