		· · · · · · · · · · · · · · · · · · ·
	TED STATES	FORM APPROVED Budget Bureau No. 1004-0135
· · · · · · · · · · · · · · · · · · ·	T OF THE INTERIOR	Expires: March 31, 1993
BUREAU OF I	LAND MANAGEMENT	5. Lease Designation and Serial No.
	AND DEPORTS ON WELLS	NM-67712
	AND REPORTS ON WELLS	6. If Indian, Allottee or Tribe Name
o not use this form for proposals to dr Use "APPLICATION FO	ill or to deepen or reentry to a different rese R PERMIT—" for such proposals	514011.
SUBMIT	IN TRIPLICATE	7. If Unit or CA, Agreement Designation
Type of Well		8. Well Name and No.
K Well Well Other	V	Julia AJL Federal #4
Name of Operator	(505) 748-1471)	9 API Well No.
YATES PETROLEUM CORPORATION	(303) 740-1471)	30-015-26934
Address and Telephone No.	Mr. 99310	10. Field and Pool, or Exploratory Area
105 South 4th St., Artesia, NM 88210		Cabin Lake Delaware
Location of Well (Footage, Sec., T., R., M., or Survey Description) 2180' FNL & 1980' FEL of Section 34-T21S-R30E (Unit G, SWNE)		11. County or Parish, State
2180' FNL & 1980' FEL of Sec	tion 34-T2IS-R3UE (Unit G, SWNE)	
		Eddy Co., NM
CHECK APPROPRIATE BOX	(s) TO INDICATE NATURE OF NOTICE,	REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF A	ACTION
	Abandonment C. S.	E mange of Plans Port IP
Notice of Intent		
	Becompletion VI V	Herew Construction 5-11-9
	Plugging Back	Non-Routine Fracturing 4
X Subsequent Report	Plugging Back	Non-Routine Fracturing
	Plugging Back Casing Repair APR 1	Non-Routine Fracturing
Subsequent Report	Plugging Back Casing Repair APR 1	8 1996 Non-Routine Fracturing
	Plugging Back Casing Repair APR 1	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Beport results of multiple completion on Well
Final Abandonment Notice	Plugging Back Casing Repair APR 1 Altering Casing Other Other	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Beport results of multiple completion on Well Completion or Report and 1 og form)
Final Abandonment Notice	Plugging Back Casing Repair Altering Casing Other Other Other All pertinent details, and give pertinent dates, including estimated that ical depths for all markers and zones pertinent to this work.)*	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Beport results of multiple completion on Well Completion or Recompletion Report and Log form) and starting any proposed work. If well is directionally drille
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged	Plugging Back Casing Repair APR 1 Altering Casing Other OIL CC all pertinent details, and give pertinent dates, including estimate ical depths for all markers and zones pertinent to this work)*	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Beport results of multiple completion on Well Completion or Recompletion Report and Log form) and starting any proposed work. If well is directionally drille pumping unit. POOH with rods
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r	Plugging Back Casing Repair Altering Casing Other Other Other All pertinent details, and give pertinent dates, including estimated that ical depths for all markers and zones pertinent to this work.)*	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Beport results of multiple completion on Well Completion or Recompletion Report and Log form) and starting any proposed work. If well is directionally drille pumping unit. POOH with rods
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for molugging operations.	Plugging Back Casing Repair APR 1 Attering Casing Other Offle CC all pertinent details, and give pertinent dates, including estimate ical depths for all markers and zones pertinent to this work)* I up pulling unit. Nippled down night. NOTE: Notified Don Early	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion of Recompletion Report and 1 og form) Completion of Recompletion Report and 1 og form)
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref	Plugging Back Casing Repair APR 1 Attering Casing Other OIL CC all pertinent details, and give pertinent dates, including estimate ical depths for all markers and zones pertinent to this work)* Up pulling unit. Nippled down night. NOTE: Notified Don Early eleased tubing anchor. POOH with	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and Log form) off starting any proposed work. If well is directionally drille pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re- auchor and tubing anchor. Ri	Plugging Back Casing Repair Altering Casing Other Other Dill CC all pertinent details, and give pertinent dates, including estima cal depths for all markers and zones pertinent to this work)* I up pulling unit. Nippled down night. NOTE: Notified Don Early eleased tubing anchor. POOH with igged up wireline. TIH with 5-1/	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Diversion of Recompletion on Well Completion or Recompletion Report and Log form) off starfing any proposed work. If well is directionally drille pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000'
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemen	Plugging Back Casing Repair APR 1 Attering Casing Other OIL CC all pertinent details, and give pertinent dates, including estimate ical depths for all markers and zones pertinent to this work)* I up pulling unit. Nippled down night. NOTE: Notified Don Early eleased tubing anchor. POOH with igged up wireline. TIH with 5-1/ ht. Rigged down wireline. TIH w	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Beport results of multiple completion on Well Completion or Recompletion Report and 1 og form) For off starting any proposed work. If well is directionally drille pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' ith tubing to 6950'. Spot
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69	Plugging Back Casing Repair Altering Casing Other Othe	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Completion or Recompletion Report and Log form) Completion Completion Recompletion Recompletion Report and Log form) Completion Completion Recompletion Recompletio
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of	Plugging Back Casing Repair Attering Casing Other Othe	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and 1 og form) Completion or Recompletion Recomp
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 25	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Completion or Recompletion Report and Log form 1 Completion or Recompletion Recompletion Recompletion of Recompletion Rec
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. Se	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Dispose Water Completion or Recompletion Report and Log form 1 Completion or Recompletion Recompletion Recompletion of Recompletion Rec
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing	Plugging Back Casing Repair Attering Casing Other Othe	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and Log form) off starting any proposed work. If well is directionally drille pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' ith tubing to 6950'. Spot H with tubing to 5550'. Mixe casing). POOH with tubing -5180' (in 5-1/2" casing). on Early w/BLM witnessed ceme sacks Class C cement from
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and Log form) Completion Completion Recompletion Report and Log form) Completion Completion Recompletion Recompletion Completion Co
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing	Plugging Back Casing Repair Attering Casing Other Othe	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and 1 og form 1 off starting any proposed work. If well is directionally drilled pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' ith tubing to 6950'. Spot H with tubing to 5550'. Mixe casing). POOH with tubing -5180' (in 5-1/2" casing). on Early w/BLM witnessed ceme sacks Class C cement from ean. Shut well in. POOH with tubing. Rigged up
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with tubing and wireline. TIH with perforat:	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Completion or Recompletion Report and Log form) Completion Completion Recompletion Recompletion of Recompletion Recompletion Recompletion Recompletion of Recompletion Rec
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 25 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with tubing and wireline. TIH with perforat: TIH with 5-1/2" cement retain	Plugging Back Casing Repair Altering Casing Other Othe	8 1996 Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Diversion of Recompletion Report and Log form) Completion or Recompletion Report and Log form) Completion Completion Report and Log form) Completion Completion Recompletion Report and Log form) Completion Completion Recompletion Reco
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 25 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with tubing and wireline. TIH with perforat: TIH with 5-1/2" cement retain	Plugging Back Casing Repair Altering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Completion or Recompletion Report and Logform) Completion Completion Report and Completion Com
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Pispose Water Diversion of Recompletion Report and Log form) Completion or Recompletion Report and Log form) Completion Completion Report and Completion Report and Log form) Completion Completion Report and Completion Report and Log form) Completion Completion Report and Report and Completion Report and Completion Report and Completion Report and Completion Report and Report and Completion Report and Report
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X	Plugging Back Casing Repair Altering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion Report and Log form) Completion of Recompletion Report and Log form) Completion Completion Recompletion Recompletion of Recompletion of Recompletion Recomp
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water Completion or Recompletion on Well Completion or Recompletion Report and Log form) and starting any proposed work. If well is directionally drille pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' ith tubing to 6950'. Spot H with tubing to 5550'. Mixe casing). POOH with tubing -5180' (in 5-1/2" casing). On Early w/BLM witnessed ceme sacks Class C cement from ean. Shut well in. POOH with tubing. Rigged up 387'. Rigged down wireline. Xed and pumped 65 sacks Class own 5-1/2" casing and out at cement retainer and pumped 5 WED ON NEXT PAGE:
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X	Plugging Back Casing Repair Altering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Completion or Recompletion Report and Logform) Completion of Recompletion Report and Logform) Completion Completion Recompletion Completion (Completion Recompletion Recompletion Recompletion Recompletion Recompletion (Completion Recompletion (Completion Recompletion R
Final Abandonment Notice Final Abandonment Notice Describe Proposed or Completed Operations (Clearly states give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for re- plugging operations. 3-15-96 - Nippled up BOP. Re- anchor and tubing anchor. Ri- Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. Se plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X 14. I hereby certify that the foregoing is true perforated Signed Mathematical States	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Dispose Water D
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Ref anchor and tubing anchor. Rif Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X 14.1 hereby certify that the foregoing is true anti-correct Signed	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing With Water Shut-Off Conversion to Injection Dispose Water Conversion to Injection Dispose Water Completion or Recompletion Report and Log form) off starting any proposed work. If well is directionally drilled pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' tith tubing to 6950'. Spot H with tubing to 5550'. Mixed casing). POOH with tubing -5180' (in 5-1/2" casing). On Early w/BLM witnessed ceme sacks Class C cement from ean. Shut well in. POOH with tubing. Rigged up 387'. Rigged down wireline. Ixed and pumped 65 sacks Class fown 5-1/2" casing and out at cement retainer and pumped 5 MED ON NEXT PAGE:
Final Abandonment Notice Describe Proposed or Completed Operations (Clearly state give subsurface locations and measured and true vert 3-14-96 - Moved in and rigged and pump. Shut well in for r plugging operations. 3-15-96 - Nippled up BOP. Re anchor and tubing anchor. Ri Capped CIBP with 35' of cemer 150 bbls plugging mud from 69 and pumped 25 sacks Class C of to 5280'. Mixed and pumped 22 POOH with tubing to 3600'. S plugs. 3-16-18-96 - POOH with tubing 3475-3375'. POOH with tubing 3475-3375'. POOH with tubing 3-19-96 - TIH with perforat: TIH with 5-1/2" cement retain C cement as follows: pumped perforations and up 5-1/2" X 4 Thereby certify that the foregoing is true perforated Signed	Plugging Back Casing Repair Attering Casing Other Othe	Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water Completion or Recompletion on Well Completion or Recompletion Report and Log form) and starting any proposed work. If well is directionally drillee pumping unit. POOH with rods w/BLM-Carlsbad of commencing tubing, seating nipple, mud 2" CIBP and set CIBP at 7000' ith tubing to 6950'. Spot H with tubing to 5550'. Mixed casing). POOH with tubing -5180' (in 5-1/2" casing). On Early w/BLM witnessed ceme sacks Class C cement from ean. Shut well in. POOH with tubing. Rigged up 387'. Rigged down wireline. Xed and pumped 65 sacks Class own 5-1/2" casing and out at cement retainer and pumped 5 WED ON NEXT PAGE: