			- ON DIV SEL
•			OIL CONSERVATION DIV OIL CONSERVATION DIV 811 S. 1st ST. 811 S. 1st ST. 811 S. 1st ST. 811 S. 1st ST. 812 State St
			OIL CONSET. 2010-2834
Form 3160-5	UNI	TED STATES	ALL S. 151 NAM APPROVED
(June 1990)		T OF THE INTERIOR	ATES Budget Bureau No. 1004-0135
	BUREAU OF LAND MANAGEMENT		Expires: March 31, 1993
	Dendario OI		5. Lease Designation and Serial No.
9	SUNDRY NOTICES	AND REPORTS ON WELLS	
Do not use this form	n for proposals to dr	ill or to deepen or reentry to a different res	6. If Indian, Allottee or Tribe Name
Use	e "APPLICATION FO	R PERMIT—" for such proposals	
			7. If Unit or CA, Agreement Designation
	SUBMIT		7. If Onit of CA, Agreement Designation
1. Type of Well			
Vil Gas (Other	JUL 1 1 199	8. Well Name and No.
2. Name of Operator			TOG Fed. #6
J. C. Willia	mson		in a g. API Well No.
3. Address and Telephone No.			<u>9</u>
C./O. P.O.	Box 888 Hobbs,	NM 88241-0888 505-392-7050	
4. Location of Well (Footage,	Sec., T., R., M., or Survey D	escription)	10. Field and Pool, or Exploratory Area Burton Flat Dolevano
990' FSL & 2		• • • • •	Burton Flat Delaware
Sec. 16-T20S			11. County of Parisn, State
			Eddy County New Marrie
12. CHECK AF			Eddy County, New Mexico
	PHOPHIATE BOX(s) TO INDICATE NATURE OF NOTICE,	REPORT, OR OTHER DATA
TYPE OF SU	BMISSION	TYPE OF A	CTION
	ilicin (Change of Plans
X Subsequent	Report		
CID Subsequeix	Report		Non-Routine Fracturing
C -1	damana Madaa	Casing Repair	Water Shut-Off
Einel Aband			
L_ Final Aband	JOILINEIR MOLICE	Altering Casing	Conversion to Injection
L_J Final Aband	JOILINEIR NOUCE	X Other <u>Running 9 5/8 (</u>	casing Dispose Water
		X Other <u>Running 9 5/8 (</u>	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Lee form)
13. Describe Proposed or Compl	leted Operations (Clearly state a)	Conter <u>Running 9 5/8 (</u>	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Lee form)
13. Describe Proposed or Compl	leted Operations (Clearly state a)	X Other <u>Running 9 5/8 (</u>	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Lee form)
13. Describe Proposed or Compl give subsurface location	leted Operations (Clearly state al ns and measured and true vertic	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)*	CASING Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled,
13. Describe Proposed or Compl give subsurface location Drill out of	leted Operations (Clearly state al ns and measured and true vertic f 13 3/8" casing	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-2	<u>Casing</u> Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2	leted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run	<u>Casing</u> Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#,
13. Describe Proposed or Completing ive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C completing to the subsurface of the su	eted Operations (Clearly state al ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so	<u>Casing</u> Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2,	leted Operations (Clearly state al ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12.	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Cal	<u>Casing</u> Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to 	eted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface.	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)* with 12 1/4" bit at 11:45 PM 2-7 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BO	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to 	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertinent details, and give pertinent dates, including estimated date cal depths for all markers and zones pertinent to this work.)* with 12 1/4" bit at 11:45 PM 2-7 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BO	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	 Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	 Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. I 18 hrs. Nipple up BOP. Test BOD -96	<u>Casing</u> Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. I 18 hrs. Nipple up BOP. Test BOD -96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state al ns and measured and true vertic 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. I 18 hrs. Nipple up BOP. Test BOD -96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
13. Describe Proposed or Compl give subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c	leted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. I 18 hrs. Nipple up BOP. Test BOD -96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c Plug down at Plug down at 	leted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* (with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c Plug down at 14. I hereby certify that the fore Signed	eted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 4</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* 3 with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca0 at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96 <u>Title</u> <u>Agent</u>	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C C + 2% CaCl2, circulate to casing and c Plug down at 14. I hereby certify that the fore Signed	leted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 (</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* (with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca(at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96	Casing Dispose Water (Note: Report results of multiple completion on Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes. Mmms
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C C + 2% CaCl2, circulate to casing and c Plug down at Plug down at 	eted Operations (Clearly state all as and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 4</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* 3 with 12 1/4" bit at 11:45 PM 2-1 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca0 at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 7-96 <u>Title</u> <u>Agent</u>	Casing Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) of starting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal C12 (y1d-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c Plug down at Plug down at 14. I hereby certify that the formation of space for Federal or S Approved by Conditions of approval, if a 	eted Operations (Clearly state all as and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other	Casing Dispose Water (Note: Report results of multiple completion on Recompletion Report and Log form.) constrting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.
 13. Describe Proposed or Compligive subsurface location Drill out of at 5:45 PM 2 S-95, LT&C c + 2% CaCl2, circulate to casing and c Plug down at Plug down at 14. I hereby certify that the formation of signed	eted Operations (Clearly state all ns and measured and true vertic f 13 3/8" casing 2-17-96 at total casing. Set cas (y1d-1.93 @ 12. o surface. TOC cementing. WOC t 11:30 PM 2-17	X Other <u>Running 9 5/8 4</u> Il pertiment details, and give pertiment dates, including estimated date cal depths for all markers and zones pertiment to this work.)* 3 with 12 1/4" bit at 11:45 PM 2-1 4 depth of 1195'. Rig up and run sing at 1195'. Cement with 265 so 5#), + 200 sx. Class "C" + 2% Ca0 at 79'. Ready mix to surface. If 18 hrs. Nipple up BOP. Test BOD 2-96	Casing Dispose Water (Note: Report results of multiple completion on Recompletion Report and Log form.) constrting any proposed work. If well is directionally drilled, 16-96. Drill 12 1/4" hole 32 jts, 1200', 9 5/8", 40#, x. PSL "C" + 1/4#/sx celloseal Cl2 (yld-1.32 @ 14.8). Did not BLM Carlsbad notified of running P to 1000 for 30 minutes.

ÿ

きょう 時

ļ

,

*See instruction on Reverse Side