

- a) 1500 gals gel pad
 - b) 500 gals gel + 1 ppg 20/40 RC sand
 - c) 500 gals gel + 2 ppg 20/40 RC sand
 - d) 500 gals gel + 3 ppg 20/40 RC sand
 - e) 1000 gals gel + 4 ppg 20/40 RC sand
 - f) flush to top perf
- SWI to allow resin to cure.

- 27. Make couple of swab runs.
- 28. Release pkr. Drop down and catch RBP. TOH w/ RBP, pkr, & tbq.
TIH w/ pumping equipment. Place well on production from all perfs
6840-7991'.