Submit 3 Copies		New Mexico	5 Form C-103
to Appropriate District Office	Energy, Minerals and N	latural Resources Department	C Revised 1-1-89
<u>DISTRICT I</u> P.O. Box 1980, Hobba, NM 88240		ATION DIVISION Box 2088	WELL API NO.
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New 1	Mexico 87504-2088	30-015-27728 5. Indicate Type of Lease STATE XX FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410)		6. State Oil & Gas Lease No.
SHNORY NO	TICES AND REPORTS	ON WELLS	V-4399
(DO NOT USE THIS FORM FOR P DIFFERENT RES		DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
1. Type of Well: OL CAS WEL WELL	X OTHER	MAR 1990	Indian Hills ARG State
2. Name of Operator YATES PETROLEUM CORPO	ORATION	RECEIVED DCD - ARTESIA	8. Well Na.
3. Address of Operator			9. Pool name or Wildcat
105 South 4th St., An 4. Well Location	rtesia, NM 88210	·	Wildcat Morrow
Unit Letter <u>M</u> : <u>6</u> Section 36	Township 21S	Range 24E	60 Feet From The West Line NMPM Eddy County
	10. Elevation (Sho	w whether DF, RKB, RT, GR, etc.) 3814 GR	
		dicate Nature of Notice, I	-
NOTICE OF I	NTENTION TO:	SU	BSEQUENT REPORT OF:
	PLUG AND ABANDON		
TEMPORARILY ABANDON	CHANGE PLANS		
	CHANGE PLANS		
PULL OR ALTER CASING	CHANGE PLANS	CASING TEST AND (
PULL OR ALTER CASING		CASING TEST AND C	CEMENTJOB
PULL OR ALTER CASING	erations (Clearly state all periment cation, set and te gged up wireline. ools. Rigged down bing with 500 gall h tubing, scraper guns and perforate 172-10204' (2 SPF knock out plug, p 5K tree. Dropped Shut well in. 1 down. Nippled da	CASING TEST AND C OTHER: Perform details, and give performent dates, inclusion sted anchors. Moved TIH with logging to wireline. TIH with ons 15% iron control and bit. Rigged up d 10151-10204' w/92 - Morrow). TOOH with acker and tubing. N bar to knock out pl own tree. Nippled u reline with full lub	Ate & acidize X Auting estimated date of starting any proposed A in and rigged up pulling unit. bols and ran CBL/GR/CCL log. h bit, scraper and tubing. HCL acid. Tested casing to wireline with full lubricator. .42" holes as follows: th casing guns and rigged down Nippled downBOP. Set packer at Lug. Flowed well down. Swabbing App BOP. Released packer. TOOH pricator. TIH with CIBP and set
PULL OR ALTER CASING	erations (Clearly state all persinent cation, set and te gged up wireline. ools. Rigged down bing with 500 gall h tubing, scraper guns and perforate 172-10204' (2 SPF knock out plug, p 5K tree. Dropped Shut well in. 1 down. Nippled d ker. Rigged up wi sted to 2000 psi.	CASING TEST AND C OTHER: Perform details, and give pertinent dates, inc. sted anchors. Moved TIH with logging to wireline. TIH with ons 15% iron control and bit. Rigged up d 10151-10204' w/92 - Morrow). TOOH with acker and tubing. N bar to knock out pl own tree. Nippled u reline with full lub TIH with 4" casing	Ate & acidize X ate & acidize X Muling estimated date of starting any proposed d in and rigged up pulling unit. bols and ran CBL/GR/CCL log. h bit, scraper and tubing. HCL acid. Tested casing to wireline with full lubricator. .42" holes as follows: th casing guns and rigged down Nippled downBOP. Set packer at Lug. Flowed well down. Swabbing ap BOP. Released packer. TOOH pricator. TIH with CIBP and set
PULL OR ALTER CASING	erations (Clearly state all persinent cation, set and te gged up wireline. ools. Rigged down bing with 500 gall h tubing, scraper guns and perforate 172-10204' (2 SPF knock out plug, p 5K tree. Dropped Shut well in. 1 down. Nippled d ker. Rigged up wi sted to 2000 psi.	CASING TEST AND C OTHER: Perform details, and give pertinent dates, inc. sted anchors. Moved TIH with logging to wireline. TIH with ons 15% iron control and bit. Rigged up d 10151-10204' w/92 - Morrow). TOOH with acker and tubing. N bar to knock out pl own tree. Nippled u reline with full lub TIH with 4" casing owledge and belief.	CEMENT JOB X Atte & acidize X Auting estimated date of starting any proposed X I in and rigged up pulling unit. Dools and ran CBL/GR/CCL log. I bit, scraper and tubing. X I HCL acid. Tested casing to Wireline with full lubricator. .42" holes as follows: X th casing guns and rigged down X Nippled downBOP. Set packer at X Lug. Flowed well down. Swabbing X Depricator. TIH with CIBP and set X GONTINUED ON NEXT PAGE: X
PULL OR ALTER CASING	erations (Clearly state all periment cation, set and te gged up wireline. ools. Rigged down bing with 500 gall h tubing, scraper guns and perforate 172-10204' (2 SPF knock out plug, p 5K tree. Dropped Shut well in. 1 down. Nippled d ker. Rigged up wi sted to 2000 psi.	CASING TEST AND C OTHER: Perform details, and give pertinent dates, inc. sted anchors. Moved TIH with logging to wireline. TIH with ons 15% iron control and bit. Rigged up d 10151-10204' w/92 - Morrow). TOOH with acker and tubing. N bar to knock out pl own tree. Nippled u reline with full lub TIH with 4" casing owledge and belief.	Ate & acidize X Auting estimated date of starting any proposed X In and rigged up pulling unit. X Dols and ran CBL/GR/CCL log. X In bit, scraper and tubing. X It HCL acid. Tested casing to X Wireline with full lubricator. .42" holes as follows: Chasing guns and rigged down X Nippled downBOP. Set packer at X Lug. Flowed well down. Swabbing X Applied packer. TOOH X Applied and perforated 10022-10034' X
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed Op work) SEE RULE 1103. 3-3-98 - Cleaned lo Nippled up BOP. Ri TOOH with logging t Shut down. 3-4-98 - Pickled tu 2500 psi. TOOH wit TIH with 4" casing 10151-10163' and 10 wireline. TIH with 10117'. Nippled up 3-5-98 - Swabbed. 3-6-98 - Flowed wel with tubing and pac CIBP at 10130'. Te I hereby caufy that the information above is SKONATURE TYPE OR PRINT NAME Rusty Kle	erations (Clearly state all periment cation, set and te gged up wireline. ools. Rigged down bing with 500 gall h tubing, scraper guns and perforate 172-10204' (2 SPF knock out plug, p 5K tree. Dropped Shut well in. 1 down. Nippled d ker. Rigged up wi sted to 2000 psi.	CASING TEST AND C OTHER: Perform details, and give pertinent dates, inc. sted anchors. Moved TIH with logging to wireline. TIH with ons 15% iron control and bit. Rigged up d 10151-10204' w/92 - Morrow). TOOH wit acker and tubing. N bar to knock out pl own tree. Nippled u reline with full lut TIH with 4" casing owledge and belief. Operations	CEMENT JOB ate & acidize Auting estimated date of starting any proposed d in and rigged up pulling unit. bols and ran CBL/GR/CCL log. n bit, scraper and tubing. d HCL acid. Tested casing to wireline with full lubricator. .42" holes as follows: ch casing guns and rigged down Nippled downBOP. Set packer at lug. Flowed well down. Swabbing up BOP. Released packer. TOOH oricator. TIH with CIBP and set guns and perforated 10022-10034' CONTINUED ON NEXT PAGE: Technician DATE