to Appropriate District Office	State of New Energy, erals and Natur	w Mexico ral Resources Department	Form C-103 Revised 1-1-89
<u>DISTRICT I</u> P.O. Box 1980, Hodds, NM 88240	OIL CONSERVATION DIVISION P.O. Box 2088		Well API NO. 30-015-28531
DISTRICT II P.O. Drawer DD, Antesia, NM 88210	Santa Fe, New Mex	xico 87504-2088	5. Indicate Type of Lease STATE FEE X
<u>DISTRICT III</u> 1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lease No.
( DO NOT USE THIS FORM FOR PRO DIFFERENT RESEI	ICES AND REPORTS ON OPOSALS TO DRILL OR TO DES RVOIR. USE "APPLICATION FO 2-101) FOR SUCH PROPOSALS.	EPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
1. Type of Well: OIL GAS WELL X WELL	OTHER	/	Mojave AJY Com
2. Name of Operator YATES PETROLEUM CORPOR	24TTON		8. Well No.
3. Address of Operator		· · · · · · · · · · · · · · · · · · ·	9. Pool name or Wildcat
105 South 4th St., Art	cesia, NM 88210		Dagger Draw Upper Penn, South
4. Well Location		100	
Unit Letter : 660	Feet From The South	Line and198	0 Feet From The East Line
Section 35	10. Elevation (Show w	h Range 23 East hether DF, RKB, RT, GR, etc.) 1' GR	NMPM Eddy County
11. Check NOTICE OF IN	Appropriate Box to India TENTION TO:		Report, or Other Data BSEQUENT REPORT OF:
	PLUG AND ABANDON		ALTERING CASING
	CHANGE PLANS		G OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING		CASING TEST AND C	ement job 🔲 👘 🗄 10 3 1395
OTHER:		OTHER: Product	ion casing & cement
12. Describe Proposed or Completed Oper	ations (Clearly state all pertinent det	ails, and give pertinent dates, inclu	wling estimated date of starting any proposed
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); 3487.05') and 34 joi	95, Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55	s of 7" 26# & 23# casing as follo 5# J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 810	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at )8'. Float collar s	95, Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float show set at 8149'. DV t	s of 7" 26# & 23# casing as follo 5# J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of 2 set at 8150'. Safety Port 2001 set at 5830'. Cemented in
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 810 two stages as follows CF-14A. 3.42#/sack sa	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); B487.05') and 34 joi Float shoe set at D8'. Float collar s s: Stage 1: 600 sa alt and 8#/sack hise	95. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float show set at 8149'. DV t acks Super C Modifi eal (yield 1.68, we	s of 7" 26# & 23# casing as follo # J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of a set at 8150'. Safety Port cool set at 5830'. Cemented in ied (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95.
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 810 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2	0 at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at 08'. Float collar s s: Stage 1: 600 sa alt and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces	95, Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float shoe set at 8149'. DV t acks Super C Modifi eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s	s of 7" 26# & 23# casing as follo 5# J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of 2 set at 8150'. Safety Port cool set at 5830'. Cemented in ied (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95 cks. Circulate through DV tool sack gilsonite, 5#/sack salt,
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 8100 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18. weight 15.6).	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at 08'. Float collar s at and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95.	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float shoe set at 8149'. DV t acks Super C Modiff eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in . Bumped plug to 2	s of 7" 26# & 23# casing as follo # J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of a set at 8150'. Safety Port cool set at 5830'. Cemented in ted (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95 cks. Circulate through DV tool sack gilsonite, 5#/sack salt, with 200 sacks "H" Neat (yield 2800 psi for 5 minutes, OK.
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 810 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18, weight 15.6). Circulated 73 sacks.	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); B487.05') and 34 joi Float shoe set at 08'. Float collar s at and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95. WOC. Released rig	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float show set at 8149'. DV t acks Super C Modiff eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in . Bumped plug to 2 g at 5:45 PM 7-29-5	s of 7" 26# & 23# casing as follo # J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of a set at 8150'. Safety Port cool set at 5830'. Cemented in ted (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95 cks. Circulate through DV tool sack gilsonite, 5#/sack salt, with 200 sacks "H" Neat (yield 2800 psi for 5 minutes, OK.
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 8100 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18, weight 15.6). Circulated 73 sacks. blasted casing from 6 Waiting on completion	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at 08'. Float collar s at and 8#/sack hise osi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95. WOC. Released rig 6150-6550'and 7500-8 n unit.	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float shoe set at 8149'. DV t acks Super C Modiff eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in . Bumped plug to 2 g at 5:45 PM 7-29-9 8150'.	s of 7" 26# & 23# casing as follo # J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of a set at 8150'. Safety Port cool set at 5830'. Cemented in ted (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95 cks. Circulate through DV tool sack gilsonite, 5#/sack salt, with 200 sacks "H" Neat (yield 2800 psi for 5 minutes, OK.
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3) casing set at 8150'. sub collar set at 8100 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18, weight 15.6). Circulated 73 sacks. blasted casing from 6 Waiting on completion Thereby certify that the information above is to the stage of the same state	) at 11:45 AM 7-27-9 N-80 8rd (584.52'); B487.05') and 34 joi Float shoe set at 08'. Float collar s at and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95. WOC. Released rig 6150-6550' and 7500-8 n unit.	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float shoe set at 8149'. DV t acks Super C Modiff eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in . Bumped plug to 2 g at 5:45 PM 7-29-5 8150'.	s of 7" 26# & 23# casing as follo 5# J-55 8rd (2694.25'); 87 joints 58rd (1385.58') (Total 8151') of 58rd (1385.58') (Total 8150
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 810 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18, weight 15.6). Circulated 73 sacks. blasted casing from 6 Waiting on completion I hereby certify that the information above is to sionATURE Rusty Klad	at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at 08'. Float collar s s: Stage 1: 600 sa alt and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95. WOC. Released rig 6150-6550' and 7500-8 n unit. my and complete to the best of my throwle	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float shoe set at 8149'. DV t acks Super C Modiff eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in . Bumped plug to 2 g at 5:45 PM 7-29-5 8150'.	clerk <u>August 1, 199</u>
12. Describe Proposed or Completed Oper work) SEE RULE 1103. TD 8150'. Reached TD 14 joints of 7" 26# N of 7" 23# J-55 8rd (3 casing set at 8150'. sub collar set at 8100 two stages as follows CF-14A, 3.42#/sack sa Bumped plug to 2000 p for 4 hours. Stage 2 1/4#/sack celloseal ( 1.18, weight 15.6). Circulated 73 sacks. blasted casing from 6 Waiting on completion I hereby certify that the information above is to skonature Type or PRINT NAME Rusty Klef	at 11:45 AM 7-27-9 N-80 8rd (584.52'); 8487.05') and 34 joi Float shoe set at 08'. Float collar s s: Stage 1: 600 sa alt and 8#/sack hise psi for 5 minutes. 2: 1050 sacks Paces (yield 2.01, weight PD 1:45 PM 7-29-95. WOC. Released rig 6150-6550' and 7500-8 n unit. my and complete to the best of my throwle	25. Ran 200 joints 65 joints of 7" 26 ints of 7" 26# J-55 8150'. Float show set at 8149'. DV t acks Super C Modifi eal (yield 1.68, we Circulated 117 sac setter Lite C, 5#/s 12.5). Tailed in Bumped plug to 2 g at 5:45 PM 7-29-9 8150'.	s of 7" 26# & 23# casing as follo 5# J-55 8rd (2694.25'); 87 joints 5 8rd (1385.58') (Total 8151') of a set at 8150'. Safety Port cool set at 5830'. Cemented in ted (61-15-11), .4% CF-2, .4% eight 13.0). PD 7:45 AM 7-29-95. eks. Circulate through DV tool sack gilsonite, 5#/sack salt, with 200 sacks "H" Neat (yield