

**STATE OF NEW MEXICO 20 #1
SUPPLEMENTAL COMPLETION PROCEDURE**

Page 2

July 24, 1997

9. RU Western Atlas ELU and perforate the Morrow "B" as follows:

11118' - 11128' 6 SPF 60° Phasing Dyna Star Strip Gun w/ Gamma Ray Correlation

Correlate to Western Atlas Open Hole Log, Run #1, dated 19 MAR 97. POOH. Report any surface pressure changes. RD and release electricline unit.

10. Flow back to frac tank to clean up. Upon cleanup switch to production equipment and monitor and report flow rates and pressures. Based on results may run a BHP build up. If frac is required design to follow.

ATTACHMENTS

Log Strip
Wellbore Sketchs

NOTES:

1. Hold brief safety meeting before commencing operations each morning and before commencing individual critical operations (perforating, fracturing, drilling plugs, etc.).
2. Sign all field tickets. Code field tickets with AFE # and ACCOUNT CODE.
3. Inform all vendors that signed and coded field tickets must accompany invoice before payment will be authorized.