

HACKBERY "31" STATE #1

1. Run tubing to 10400'.
2. Load hole with 450 bbls. gelled brine.
3. Spot 25 sx. cement 10170' - 10400'. WOC. Tag Plug.
4. Perf 4 holes @ 8440'.
5. Set cement retainer @ 8440'. Squeeze perfs @ 8440' with 50 sx. cement.
6. Perf 4 holes @ 6200'.
7. Set cement retainer @ 6150'. Squeeze perfs 6200' with 50 sx. cement.
8. Perf 4 holes at 4800'.
9. Set cement retainer @ 4750'. Squeeze perfs 4800' with 50 sx. cement.
10. Cut 7" csg. at free point & pull. * 100' cement Plug 50' in + 50' out of 7" csg. stub. Tag
11. Spot 75 sx. cement 1550' - 1750'. WOC. Tag plug.
12. Spot 50 sx. cement 550' - 675'. WOC. Tag plug.
13. Spot 5 sx. 3' - 10'. * 10 sx surface plug
14. Cut off csg. head. Cap with 1/4" steel plate.