

CATCLAW DRAW UNIT #35-2

Section 35-T21S-R25E
Eddy County, New Mexico

PROCEDURES TO PLUG & ABANDON

1. Set a 4.5" Cement Retainer at 2100', on tubing. Establish a pump-in rate into perfs at 2145-2175'.
2. Mix & pump 50 sxs of cement. After pumping approximately half of the cement below the retainer, unsting and displace the rest of cement on top of the retainer. This will provide about 329' of fill up inside the 4 1/2 inch casing.
3. TOH to at least 1600' and circulate hole with plug mud.
4. POOH with tubing & stinger to 310' (which is 50' below the 10 3/4" casing shoe).
5. Mix and pump 25-30 sxs of cement which should fill the 4 1/2" casing to surface.
6. TOOH with tubing.
7. Cut off wellhead and install dry hole marker per BLM specifications.
8. Remove all equipment and restore location per BLM specifications (refer to original drilling permit for grass/seed mix).