Form 3160-5			
Form 3160-5 UNITED STATES		D STATES	FORM APPROVED Budget Bureau No. 1004-0135
(June 1990)		OF THE INTERIOR	Expires: March 31, 1993
	BUREAU OF LA	ND MANAGEMENT	5. Lease Designation and Serial No.
SUNDRY NOTICES AND REPORTS ON WELLS			NM-76919
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.			5. If Indian, Allottee or Tribe Name
		ERMIT – " for such proposals	
SUBMIT IN TRIPLICATE			7. If Unit or CA, Agreement Designation
1. Type of Well Qil Gas Well Well		8. Weil Name and No.	
2. Name of Operator			Roaring Springs No. 3
Santa Fe Energy	y Resources, Inc.		"14" Federal 9. API Well No.
3. Address and Telephone No.			30-015-29956
550 W. Texas, Suite 1330, Midland, TX 79701 915/686-6612 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			10. Field and Pool, or exploratory Area
		•	
(P), 990 FSL a	and 990' FEL, Sec. 14,	1-215, R-23E	11. County or Parish, State
	APPROPRIATE ROY(s)	TO INDICATE NATURE OF NOTICE, REPOR	
		TYPE OF ACTIC	
Notice	of Intent	Abandonment	Change of Plans
X Subsequ		Recompletion	New Construction
L Subsequ	uent Report	Plugging Back	Non-Routine Fracturing
Final A	bandonment Notice	Casing Repair	Water Shut-Off
		Altering Casing	Conversion to Injection
		X Other <u>Spud & ran casing</u>	Dispose Water (Note: Report results of multiple completion on Well
. Describe Proposed or Com	oleted Operations (Clearly state all per	rtinent details, and give pertinent dates, including estimated date of st	Completion or Recompletion Report and Log form.)
give subsurface lo	cations and measured and true vertical	depths for all markers and zones pertinent to this work.)*	and any proposed work. It won is an ectionary and
2/25/98: Spud	14-3/4" hole at 7:00 a	.m. CDT. Drilling ahead.	
		') at 10:30 p.m. Prep to run surface ca	
3/01/98: TD 14	-3/4" hole (Depth 1206	Jac 10.50 p.m. Prep to run surface ca	asing.
3/02/98: RU cs and cement casi	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick	: 1206', FC @ 1128'. RU BJ Cement did not circulate.
3/02/98: RU cs and cement casi Plug down at 5: from 800' to 520 3/03/98: RIH w	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2.	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C	: 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1". tag cement @ 205'.
3/02/98: RU cs and cement casis Plug down at 5:4 from 800' to 520 3/03/98: RIH w, Cmt'd thru 1" w, and release Unit 3/04/98: Move	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2. ted Rig #5. in and RU WEK Rig #1.	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick Cement w/ 100 sx "C" + 4% CaCl2. WOC.	2 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1", tag cement @ 205'. 2 6:00 a.m. 3/3/98. Rig down
3/02/98: RU cs and cement casin Plug down at 5:- from 800' to 520 3/03/98: RIH w. Cmt'd thru 1" w. and release Unit 3/04/98: Move DCs. RIH and ta	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2. ted Rig #5. in and RU WEK Rig #1. ag cmt at 1105'. Resum	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick Cement w/ 100 sx "C" + 4% CaCl2. WOC. . Circ'd 10 sx to pit. Job complete at NU BOPs. Test blind rams and casing to me drilling operations.	: 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1", tag cement @ 205'. : 6:00 a.m. 3/3/98. Rig down 1500 psi, ok. PU bit &
3/02/98: RU cs and cement casis Plug down at 5: from 800' to 520 3/03/98: RIH w. Cmt'd thru 1" w. and release Unit 3/04/98: Move DCs. RIH and ta	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2. ted Rig #5. in and RU WEK Rig #1. ag cmt at 1105'. Resum	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick Cement w/ 100 sx "C" + 4% CaCl2. WOC. . Circ'd 10 sx to pit. Job complete at NU BOPs. Test blind rams and casing to	2 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1", tag cement @ 205'. 2 6:00 a.m. 3/3/98. Rig down
3/02/98: RU cs and cement casin Plug down at 5:- from 800' to 520 3/03/98: RIH w Cmt'd thru 1" w and release Unit 3/04/98: Move DCs. RIH and ta	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2. ted Rig #5. in and RU WEK Rig #1. ag cmt at 1105'. Resum	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick Cement w/ 100 sx "C" + 4% CaCl2. WOC. . Circ'd 10 sx to pit. Job complete at NU BOPs. Test blind rams and casing to me drilling operations.	: 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1", tag cement @ 205'. : 6:00 a.m. 3/3/98. Rig down 1500 psi, ok. PU bit &
3/02/98: RU cs and cement casis Plug down at 5:- from 800' to 520 3/03/98: RIH w. Cmt'd thru 1" w. and release Unit 3/04/98: Move DCs. RIH and ta	g crew and run 28 jts 9 ng w/ 200 sx Thixset & 45 a.m. CDT. WOC. Rar 0' in 5 stages. / 1" and tag @ 340'. (/ 50 sx "C" + 4% CaCl2. ted Rig #5. in and RU WEK Rig #1. ag cmt at 1105'. Resum	9-5/8" 36.0# K-55 ST&C casing and set at 350 sx Lite. Tail w/ 200 sx Cl "C". C n temp survey & found TOC @ 800'. Pick Cement w/ 100 sx "C" + 4% CaCl2. WOC. . Circ'd 10 sx to pit. Job complete at NU BOPs. Test blind rams and casing to me drilling operations.	: 1206', FC @ 1128'. RU BJ Cement did not circulate. up 1" pipe and raise cmt Run 1", tag cement @ 205'. : 6:00 a.m. 3/3/98. Rig down 1500 psi, ok. PU bit &

* See Instruction on Reverse Side

=