

LOWE STATE #303/25/98

TMD: 8161 TVD: 0 PBTMD: 0 PBTVD: 0
 05:00 06:00 238 A PROBLEMS / MIX LCM PILL-40#/BBL-150 BBL
 06:00 09:45 06A C TRIPPING OUT FOR LOGS /SLM 8161' /30' CORR.
 09:45 19:00 11A A LOGS / RU SCHLUMBERGER /RAN PLATFORM EXPRESS
 LOG /TD (8030') TO SURFACE / FMI TD - 7000'
 FL 4100' / RD SCHLUMBERGER
 19:00 22:00 06A B TRIPPING IN HOLE
 22:00 00:00 03A C REAMING 6 JTS TO BOTTOM (8161') 30' CORR.
 TO SLM
 00:00 05:00 06A H TRIPPING / LAYING DOWN DP

03/26/98

TMD: 8161 TVD: 0 PBTMD: 0 PBTVD: 0
 05:00 06:45 06A D TRIPPING / LDDP-DC
 06:45 15:30 12A A RUN CASING/RU BULL ROGERS CSG TOOLS / RAN
 190 JTS 7" 23#/26#,L-80/K-55 CSG/ (8166')
 WASH 4 JTS TO BOTTOM /SET 8161' /DAVIS-LYNCH
 PACKER-STAGE TOOL 7239' /RD CSG TOOLS
 15:30 17:00 12A C CEMENTING / RU B-J SERVICES /CMT 1 ST STAGE
 W/120 SXS H +.06% FL-62 + 10#/SX GILSONITE
 15.6 PPG /1.19 YLD / DROP OPENING PLUG /SET
 PACKER AND OPEN STAGE TOOL
 17:00 21:00 05A A CIRC & COND MUD W/ FULL RETURNS /250 BBLS
 SULFUR WATER TO RESERVE
 21:00 22:00 12A C CEMENTING / 2 ND STAGE- LEAD;255 SXS 35/65
 C + 6% GEL /11.4 PPG /2.63 YLD /TAIL;100 SXS
 C / 14.8 PPG /1.32 YLD /BUMP PLUG /CLOSED
 STAGE TOOL
 22:00 05:00 14A NU BOPS / PU BOP /SET SLIPS /CUT OFF CSG
 NU WH /NU BOPS / MAKE READY FOR SLIM HOLE
 DRILLING

03/27/98

TMD: 8161 TVD: 0 PBTMD: 7151 PBTVD: 0
 05:00 07:00 14A NU BOPS
 07:00 08:30 26A OTHER RAN TEMP SURVEY BY PRO WIRE LINE
 TOC-4079' /TD 7151'
 08:30 17:30 14A NU BOPS / ND HYDRIL /NU 7 1/16 X 11 SPOOL
 AND 10"3000 BOP/ CHOKE MANIFOLD
 17:30 19:00 15A TEST BOPS / TEST BOP BLIND RAMS /TIGHTEN
 LEAKS / TEST 1500# /OK
 19:00 20:15 26A OTHER / PU KELLY AND STRAP
 20:15 05:00 06A D TRIPPING / PU 6 1/8" BIT /27 4 3/4" DC ON
 3 1/2" IF 13.30# S-135 DP /GOING IN HOLE
 95 JTS PU / WIND BLOWING 40-50 MPH