

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Cons.
N.M. DIV-Dist. 2
1301 W. Grand Avenue
Artesia, NM 88210
FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993
Bureau Designation and Serial No.
NM-0400512A

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Nadel and Gussman Permian L. L. C.

3. Address and Telephone No.

601 N. Marienfeld, Suite 508, Midland Tx. 79701

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1800' FSL & 840' FWL, unit letter L.
Sec. 31 - T20S - R27E

OGRID# 155615

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

27324

8. Well Name and No.

ICA 31 Fed No. 1

9. API Well No.

30-015-31587

10. Field and Pool, or Exploratory Area

Avalon Morrow

11. County or Parish, State

Eddy, Co. NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Notify the BLM 24 hrs prior to starting P&A.

2. MIRU. check well for pressure, ND tree and NU BOP. Pull tubing and pkr.

3. MIRU wireline unit and set CIBP at 9300' cap w/ 35 of cmt using a dump bailer.

4. TIH with tubing and circulate well with 10 ppg salt gel mud as per BLM requirements.

5. TOH to 8250' and spot 100' cmt plug across DV tool from 8250-8150'

TAG TOH and spot 25 sx cmt plu across surface shoe from 550'-300'

7. TOH and ladydown spot 15 sx surfac plug (approx. 150').

8. Cut off wellhead, fill annulus with cmt if necessary, weld a steel plate over csg stub and erect regulation 4' dry hole marker.

9. Remove all surface equipment, clean and remediate as necessary.

TOH AND SPOT 25SX CMT PLUG

① APPROX 4900'-5100'

(PLUG EVERY 3000')

TOH AND SPOT 25SX CMT PLUG

① APPROX 1900'-2100' ACROSS

85/8" CSG SHOE & TAG

14. I hereby certify that the foregoing is true and correct

Signed K.E. McGee
(This space for Federal or State office use)

Title Operations Engineer

Date 07/16/02

Approved by _____
Conditions of approval, if any:

Title _____

Date _____

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

NADEL AND GUSSMAN PERMIAN

ICA 31 Federal #1

1800' FSL, 840FWL, Unit L, Sec 31, 24S, 27E, Eddy County, NM

API # 30-015-31587

Elev. 3237', KB = 3252'

Proposed P & A

