

Cont'd 3160-5: Page 2

Well API # - 30-015-31846

Lease Name - Miss Money Penny Federal Com #1

Pool Name - Broke Tank Draw Wolfcamp

13. Describe proposed or completed operations.

3-23-02- Pump 20 hrs. Recovered 150 BLW w/slight gas vent at battery.

3-24-02- Pump 24 hrs. Recovered 31 BO & 154 BW. TP 200 psi.

4-22-02- MIRU El Toro Well Service. POOH with rods & pmp. ND WH & NU BOP. Rls TAC. Tally out of hole jts. GIH with Baker 4.24" CIBP & set @ 5650'. POOH & GIH w/dump bailer, dump one sack sand on CIBP @ 5650'. Load 5 1/2" csg with 120 bbls 2% KCl water. Pressures 5 1/2" csg & CIBP to 500 psi-OK. GIH & perf Wolfcamp @ 5326'-5338' w/4 JSPF=48 holes with expendable hollow carrier (Predator) 6' of stim sleeve .32 gm, .47" EHD, 36.5" penetration. FL drop 40'. GIH w/5 1/2" arrow set 1-X pkr 2 7/8" SN & jts. Set pkr @ 5258'. SION.

4-23-02- SITP slight blow. MIRU Halliburton. Load 5 1/2" csg with 6 bbls 2% KCl water. Press to 500 psi-OK. Test lines to 7000 psi. Acidize Wolfcamp zone 5326'-5328' with 2500 gals Ferchek 15%, 5 gals HAL-OS, 5 gals 19N, 8 gals/lb FE-5, 8 gal/lb H11-124c. Flush with 37 bbls of 2% KCl water with 5 gal's 19N. Pmp 500 gals Ferchek followed by 1500 gals Ferchek with 100-1.3 SG 7/8" BS's followed by 500 gals Ferchek. Flush 2 7/8" tbg with 37 bbls of 2% KCl water. Surge balls & continue job. RD Halliburton. GIH with swab. IFL @ surface. FL 1000'-3400'. Well kick off flwg. SI 30 mins to hook up chk. SITP 700 psi. Flw well to tk on full open chk. Switch well thru sep. SI 15 mins to install gas prover. SI press-340 psi. Open well on full open chk. FTP 85-90 psi.

4/24/02- FTP 85-90 on a full open chk. 720 mcf/day rate. SWI for build up.

MIRU JSI. Set B-1 check vlv in 2 7/8" API SN @ 5248'. RU I&W pmp truck & load 2 7/8" tbg with 30 bbls 10# brine wtr. TP 0. ND BOP & NU WH. SDON.

4-25-02- SITP 500 psi. Load 2 7/8" tbg with 5 bbls 10 lb brine. TP 0. GIH & pull out rods. NU 5000 psi 2 7/8" screw on FMC vlv with flow 'T', 3000 psi ball vlv, & chk. GIH with swab. Unload 30 bbls 10 lb brine water. FTP 400 psi on full open chk. Recover B 1 check vlv @ 5248'. RD JSI & El Toro. Made WH hook up to FL. RU Keltic porta check tester. Lay flare line to pit. Flow test well.

4-29-02- MIRU JSI. Set pressure bombs in SN @ 5248'.

5/08-13/02- RU Keltic Porta Check Tester. SITP 1550 psi. Flow test well.

5-14-02- SI for 5 day buildup.

5/22-present- WO pipeline hook up.