

Plugging Procedure
Delta U.S. Corporation
Missouri-New Mexico Land Co.
Com. #1 Sec. 6-23-27 Ut. O

1. Spot cement plug in 4 1/2" csg. from 11,475' to 11000'.
Woc & tag plug.
2. Spot a 25sx plug @ 8200'
3. Cut & pull 4 1/2" @ 7000' if free. Locate free point & cut if not free.
4. Spot a 40sx plug 50' in & out of csg. stub. WOC & tag plug.
5. Spot a 35sx plug @ 5400' to cover bone springs.
6. Spot a 35sx plug @ 2650' to cover 85/8" shoe. WOC & tag plug.
7. Spot a 35sx plug @ 400' to cover 133/8" shoe. WOC & tag plug.
8. Spot a 20sx plug @ surface, set P&A marker, cut anchors, clean & level location.
9. Plugging mud shall be placed between pluggs at 25lb. per bbl. of brine water.