

N.M.O.C.D.

NM OIL CONS. COMMISSION

Drawer

Artesia, NM 88210

Form 9-331
(May 1963)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 3852

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Boothe "B0" Federal

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Rock Tank Morrow

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec 12-T23S-R24E

12. COUNTY OR PARISH 13. STATE

Eddy

NM

1.

OIL WELL ☐ GAS WELL ☐ OTHER

RECEIVED

2. NAME OF OPERATOR

Gulf Oil Corporation

SEP 9 1982

3. ADDRESS OF OPERATOR

P. O. Box 670, Hobbs, NM 88240

O. C. D.

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface

ARTESIA, OFFICE

2310' FSL & 2310' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4008'

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING


ABANDONMENT*

X

(Note: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.) *

Jet cut 2-3/8" tubing at 10,167' and POH. Set CIBP at 9920'. While attempting to cap CIBP, dropped 50 sack cement plug at wrong depth; TOC 7465'. Jet cut 5 1/2" at 7350', POH with casing. GIH with tubing to 7450'. Spot cement plug across stub (60 sacks). Tag stub plug at 7140', pull up hole to 6100'. Spot 150' cement plug up to 5950', pull up hole to 4250'. Spot 150' cement plug up to 4100'; spot 150' cement plug 2575'-2425'. Tag cement plug at 2500'. Spot 25 sacks (88') cement plug 2500'-2412'. Spot 30 sacks (10') cement plug at surface. Install dry hole marker; clear and clean location. P&A complete 3-10-81.

Posted 10-2
9-10-82
P + H
Upper + Lower
2000

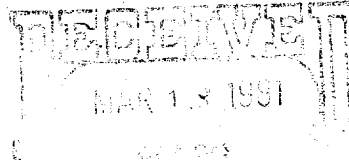

RECEIVED

MAR 12 1981

U.S. GEOLOGICAL SURVEY
ARTESIA, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

R. D. Pitzer

TITLE

Area Engineer

APPROVED

DATE

3-11-81

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

SEP 7 1982

SEP 7 1982
A. A. F.
JAMES A. CHAMBERLAIN
DEPUTY ASSISTANT