

STRACKBEIN A NO. 1 (Plug and Abandon)

10/11/2001 CMIC:gary henrich FIRST REPORT

road unit & crew to loc., move in matting boards & pipe racks, test tie down anchors, spot & rig up, sitp 920#, sicp 1100#, bleed well down to pit, load tbg. w/6 bw & tbg. press. up to 2000# & held, pump 50 bw down csg., nd tree, nu 5 k hyd. bop, try to release seal assy. w/ no success, ru swab & rih w/ no/go, tag @ 7000', try to work thru w/no success, pooh, sisd!  
L/E: \$7270 CUM L/E: \$7270

10/12/2001 CMIC:gary henrich

SITP 20# SICP 200# RIH w/ 2-375 tbg broach, sinker bar on sandline. Tagged up @ 5924'. Unsuccessfully attempted to work thru tbg. POOH w/ broach. RU swivel and torqued up tbg attempted to work seal assy. out of packer without success. RD swivel. RU Rotary wireline and RIH w/ spud bars with chisel point. Tagged up @ 5924'. Could not spud thru obstruction. POOH w/ spud bars. Manually backed off tbg. Tbg broke high. Screwed tbg back together. RU Rotary RIH backed off tbg @ 5902'. RD Rotary. POOH w/ 150 jts 2-375 buttress tbg. SION L/E: \$8624 CUM L/E: \$15894

10/15/2001 CMIC:gary henrich

400# sip, bleed well down, pooh w/43 jts. 2 3/8" buttress tbg., rih w/2 jts. tbg., x-over, 2 3/8" port sub & x-over & 191 jts. 2 3/8" tbg., screw into tbg. @ 5902', well started kicking, displace hole w/130 bw, ru rotary wl & rih w/35' string shot to 9685', try to back tbg. off w/ no success, pooh, build & rih w/larger string shot to 9685', try to back tbg. off w/no success, pooh, build & rih w/string shot to 6500', try to back tbg. off w/ no success, pooh, rd wl, sisd!  
CUM L/E: \$15894

10/16/2001 CMIC:gary henrich

sitp 310#, sicp 600#, bleed well down, ru rotary wl, rih w/35' string shot from 5950' to 5985', back tbg. off @ 5965', pooh w/ wl, pooh w/191 jts. 2 3/8" tbg., port sub & 4 jts. 2 3/8" tbg., bottom 2 jts. were plugged w/salt, rih w/195 jts. 2 3/8" tbg. to 5965', screw into tbg., ru wl, rih w/free point tools to 9650' & tag up, pu to 9640', run free point, tbg. was 100% free @ 9640', pooh, rih w/ string shot, try to back off @ 9650' w/no success, pooh, rih w/chemical cutter, cut tbg. @ 9642', pooh, rd wl, pooh laying down 122 jts. 2 3/8" buttress tbg., sisd! L/E: \$11276 CUM L/E: \$27170

10/17/2001 CMIC:gary henrich

sip 0#, finish laying down 2 3/8" tbg., unload, rack & tally 356 jts. 2 7/8" n-80 rental tbg., change rams in bop, rih w/4 5/8" bowen external cutter, 3 jts. 4 1/2" wash pipe, top bushing, x-over & 255 jts. 2 7/8" tbg. to 8122', sisd!  
L/E: \$6980 CUM L/E: \$34150

10/18/2001 CMIC:gary henrich

finish rih w/external cutter & 2 7/8" tbg. to 9640' chc, work cutter over top of fish to 9725', attempt to cut tbg. @ 9725' w/no success, release cutter & pooh w/192 jts., tools drug for 2700' & freed up, sisd! L/E: \$4848 CUM L/E: \$38998

10/19/2001 CMIC:gary henrich

finish pooh w/mech. cutter, rec. 2 jts. & 2 pieces of 2 3/8" tbg., lay down wash pipe, rih w/3 5/8" overshot & 309 jts. 2 7/8' tbg., latch onto fish @ 9820', ru rotary wl, rih w/ free point tools, tag up @ 11,230' inside of 2 3/8" tbg., 100% free @ 11,230', pooh, rd rotary, work tbg. to sting out of pkr., tbg. came free, weight indicator showed 3000# gain, pooh, no recovery, sisd!  
L/E: \$5600 CUM L/E: \$44598

10/20/2001 CMIC:gary henrich LAST REPORT

rih w/ 3 5/8" overshot & 309 jts. 2 7/8" tbg., latch onto fish @ 9820', ru rotary wl, rih w/chemical cutter & cut tbg. @ 11,219', did not indicate that tbg. cut, pooh, work tbg. to try to separate tbg. w/ no success, pkr. moved down hole 19', rih w/chem. cutter, try to cut tbg. @ 11,279' (no cut) pooh, cutter had misfired, rih w/jet cutter to 11,305', attempt to cut tbg. @ 11,305', no cut indicated, pooh, rd wl, work tbg. free & pooh w/300 jts. 2 7/8" tbg., sisd!  
L/E: \$8020 CUM L/E: \$52618

10/23/2001 CMIC:gary henrich

Ron's Welding backhoe and gang work for P&A

L/E: \$1012 CUM L/E: \$1012

10/24/2001 CMIC:gary henrich

rih & tag @ 11,057', pu to 10,740', ru haliburton, mix & pump 25 sx class H cement plug, spot plug from 10,740' - 10,504', pu to 10,070', mix & pump 25 sx class H cement, spot plug from 10,070' - 9834', pu to 8783', mix & pump 25 sx class H cement, spot plug from 8783' - 8584', pooh, sisd!  
L/E: \$4300 CUM L/E: \$5312

10/25/2001 CMIC:gary henrich

ru rotary wl, rih & shoot 2 squeeze holes @ 7000', pooh, rd wl, rih w/ bull plugged perf. sub & 224 jts. to 7050', ru haliburton, mix & pump 65 sx class H cmt., spot plug from 7050' to 6347', pooh w/ 28 jts. to 6200', pump 10 bbls. cmt into squeeze holes, rd haliburton, pooh, ru wl, rih & shoot 2 squeeze holes @ 5343', pooh, sisd! L/E: \$8596 CUM L/E: \$13908

10/26/2001 CMIC:gary henrich

rih w/ bull plugged perf. sub & 171 jts. 2 7/8" tbg. to 5397', ru haliburton, mix & pump 60 sx class C cmt. to cover from 5397' to 4795', pu to 4122', pump 7 bbls. thru squeeze holes @ 5343', si for 2 hrs., pooh, ru rotary WL, rih & tag @ 4763', pu & shoot 2 squeeze holes @ 2300', pooh, rd wl, rih w/tbg. to 2377', mix & pump 50 sx class C cmt. to cover from 2377' to 1851', pu to 1694', ru haliburton, pump 5 bbls. cmt. thru perfs., pooh, ru wl, rih & shoot 2 squeeze holes @ 1678', pooh, rd wl, rih w/tbg. to 1694', mix & pump 50 sx class C cmt. to cover from 1694' to 1188', pooh, pump 5 bbls. cmt. thru holes, ru wl, rih & shoot 2 squeeze holes @ 402', pooh, rd wl, sisd!  
L/E: \$12505 CUM L/E: \$26413

10/27/2001 CMIC:gary henrich

ru haliburton, mix & pump 90 sx class C neat cmt., pump cmt. thru perfs. @ 402', bring cmt. up to 250' behind 5.5" csg. & left 5.5" csg. full of cmt., nd bop, rig pulling unit down, clean loc., move off loc.  
L/E: \$29482 CUM L/E: \$55895

10/30/2001 CMIC:gary henrich LAST REPORT

dig out cellar, cut wellhead off, weld on dry hole marker, back fill cellar, cut off tie down anchors, job complete!  
L/E: \$900 CUM L/E: \$56795