	State of New Mexico Energy, Minerals and Natural Resources Depar	rtment Revised 1-1-89
DISTRICT I P.O. Box 1980, Hobbs, NM 88240 DISTRICT II P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410	OIL CONSERVATION DIVIS P.O. Box 2088 Santa Fe, New Mexico 87504-2088	WELL API NO. 30 - 015 - 20759 5. Indicate Type of Lease STATE FEE XX 6. State Oil & Gas Lease No.
(DO NOT USE THIS FORM FOR PRO DIFFERENT RESER (FORM C	CES AND REPORTS ON WELLS PPOSALS TO DRILL OR TO DEEPEN OR PLUG BAC RVOIR. USE "APPLICATION FOR PERMIT" 101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
Type of Well: OL WELL OL WELL OL WELL OL WELL C	<u> </u>	Union Mead Com 8. Well No.
Quinoco Petroleum, In 3. Address of Operator P.O. Box 378111, Denv		2 9. Pool name or Wildcat Wolfcamp/Morrow
4. Well Location Unit Letter <u>N</u> : <u>18</u>	80 Feet From The West Line and	660 Feet From The South Line
Section 4 11. Check NOTICE OF IN	Township22SRange27E10. Elevation (Show whether DF, RKB, RT, GR3122.8'GRAppropriate Box to Indicate Nature of NoTENTION TO:	
PERFORM REMEDIAL WORK	CASING TES	ORK ALTERING CASING DRILLING OPNS. PLUG AND ABANDONMENT T AND CEMENT JOB
work) SEE RULE 1103. Quinoco Petroleum, Ir	tions (Clearly state all pertinent details, and give pertinent a nc. proposes to plug & abandon th	he Union Mead Com #2, which is duall
as follows: 1. MIRU Pulling Unit 2. POOH w/2-7/8" & 2 3. Dump 35' of cmt of 4. Dump 25 sx cmt or 5. Dump 35' of cmt of 6. Set tbg @ 9,940' 7. Set cmt plug from 8. Pull & stretch 7- 9. Set cmt plug 50'	Kill well w/ 10#/gal brine. 2-3/8" tbg & three pkrs. on top of BP @ 11,500' i top of Morrow @ 11,060'. Tag j on top of Strawn @ 10,300'. CIBP & spot 25 sx cmt at Pennsylvani.	@ ig α ο an top @ 9,890'. Tag plug. . POOH w/7-5/8" csg & LD.
SIGNATURE	Richardson Mulu S.	<u>рs. Eng. Tech</u>
 POOH w/2-7/8" & 2 Dump 35' of cmt of Dump 25 sx cmt or Dump 35' of cmt of Set tbg @ 9,940' Set cmt plug from Pull & stretch 7- Set cmt plug 50' Set cmt plug 50' Set 100' plug @ I hereby certify that the information above is the SIGNATURE	2-3/8" tbg & three pkrs. on top of BP @ 11,500' of top of Morrow @ 11,060'. Tag on top of Strawn @ 10,300'. COAP & spot 25 sx cmt at Pennsylvania 18,619 - 8,970'. 5/8" csg & cut @ approx. 7,100' in & 50' out of stub. Tag plug Bone Springs top @ 5,150'. so' we and complete to the best of my knowledge and belief.	A io 200 an top @ 9,890'. Tag plug. POOH w/7-5/8" csg & LD. 50001 (Cont'd on back) PS. Eng. Tech. Store Tech. Store Tech. Store Tech. Store Tech. Store Tech.

- Set 100' plug @ Delaware top @ 2,030'. So to 50 and
 Set 100' plug @ 1,874' (10-3/4" csg shoe). Tag plug. So to to tot
 Set 100' plug @ 333' (13-3/8" csg shoe). Tag plug. So to tot
 Set 10 sx plug @ surface.
 ND BOP's. Release service rig.
 Reclaim surface location.

.