

mesh Ottawa sand.

11. RIH w/SLM and tag fill. Cl-an out to +5800'.
12. Swab.
13. RIH w/SLM and tag fill. Clean out if necessary. COOH w/2-7/8" tbg. and pkr.
14. GIH w/2-7/8" production tubing to +5730'.
15. Set Baker Lok-set pkr. at ±5700'. ND BOP.
16. GIH w/pump and rod string.
17. MI and set up pumping unit. Space out well and place on production.