

RECEIVED

FEB 28 1975

O. C. C.
ARTESIA, OFFICE

WELL WORK REPORT

Page 3 of

Lease Name WOOD CANYON UNIT

Well Number #1

Location

Elevation Perm. Datum

Down Hole
Condition
(after work)

Reason for Work

Date	Operation
	shop to cut new tool joint on stem and bit.
5-18-74	Lost Bit in hole--fished Bit out of hole. Filled hole up to 135' to straighten crooked hole up @ 165'.
5-19-74	Drilling and cleaning out @ 150'.
5-21-74	Straightening up crooked hole @ 165'.
5-22-74	Drilling.
5-23-74	No Report.
5-24-74	TD 180. Cleaning out and straightening hole up @ 179.
5-25-74 to 5-28-74	Straightening up crooked hole @ 165'.
5-29-74	Signed Drilling Contract with Perlap, Inc. for Rotary Rig. Will move in Rotary Rig the last of the week.
5-30-74	Move out cable tool rig and preparing to move in Rotary Rig. (Perlap, Inc. Rig #1)
5-31-74	MIRR
6-1-74 to 6-4-74	MIRURT
6-4-74	Moving in Air compressors. Will start drilling today.
6-5-74	Run TOCO Survey 3° @ 120', 3° @ 150, 4° @ 182'. Prepare to spot 95 sacks of cement with 20% sand and 2% cc on bottom to straighten up hole. Plugged down @ 1:15 p.m.. WOC.
6-6-74	Spotted 95 sacks encore cement. Picked up drill collars @ 7:00 a.m. Top cement 103' (calc. top 87') started drlg. @ 7:45 a.m. with air 1-3 min/ft. Now dusting and cleaning hole @ 115'.
6-7-74	Drilling @ 186'. Air discharge pressure 110 Psi. Turning rotary table 38 RPM and running 3000# on Bit. Drlg 50 min/ft. Will increase weight on Bit after old TD is passed.
6-8-74	Drlg @ 220'. 100% formation 80 Psi. Deviation

Signed