

Cueva Unit #1
Section 6, 2078, 1248
Eddy County, New Mexico

RECEIVED

JUN 2 1975

O. C. C.
ARTERIA, OFFICE

May 24, 1975

Rigging up at 7:00 to 3:00
Finished Rigging up at 11:00. Pick up to
210' air and ran dev. survey's heading to Wash
out to bottom 12 hrs.
Washing and reaming to bottom and dev. survey's
Drilling Survey and trip out to 210' air

May 25, 1975

Finish trip to unplug bit on wash to bottom
inanky. and lime
2 1/4 hr. Drilling 1/2 hr. Potco 2 3/4 hrs. Drilling
1/2 hr. Jet shale pit 2 1/4 hrs. drilling 3/4 mix mud lost circ.
1 1/2 hr. drilling 1 hr. mix mud last circ.
2 hr. drilling.

May 26, 1975

1 hr. Drilling W/no return footage 922' to 998'
1 hr. mix mud 1/2 hr. drilling no return
1/2 hr. mix mud 2 hrs. drlg no retrun 1 hr. mix mud
1/2 hr. drlg 1 hr. cleaning pit #2 & bld vin
Dept. 990' Dev. 20 1 hrs. finish trip to check bit
5 1/4 hrs. drilling w/ no return 1 1/4 hrs. pulled out hole left
collar on bank 1/2 hr. going in hole picking up D.P. to set
cement plug.
1/2 hr. set 100 sk plug clean & neat W/4% of 2% cc 12 1/2 Gilronile 1/4 flect
From 1039' 1/2 hr. finish running 5" DP to 1020' (per sk. plug down)
5 hrs. WOC 1 hr. trip to check cement.

May 27, 1975

From 1039' 1 1/2 hr. trip in hole W/Bit
1/2 hr. try unplug bit 1 hr. on trip out W/plug bit
1 hr. mix put of mud 3 hr. pull on stuck pp 1 hr. finish trip out
1 hr. unplug bit 5 hr. WOC 1 1/2 hr. dump 200' s x Sand in holes
1/2 hr. go in hole W/DP

May 28, 1975

1 hr. trip in hole W/DC 1 3/4 hrs. Drlg. to 402 1/2 hr. circ.
3/4 hr. Trip out W/DC & Bit 1/2 hr. Trip in W/DP 1/2 hr. Cement plug at
402' 1/2 hr. Trip out W/DR 3 hrs. WOC 2 1/2 hrs. WOC 1/4 hr. Trip in
W/DP tag cement N1 35+d single + 22' 322' 1/2 hr. Cement plug @ 322'
1/4 hr. Trip out W/DP 4 1/2 hrs. WOC 6 hrs. WOC 1/2 hr. Cement & pull
out of hole 125 sks at 292' 1 1/2 hrs. WOC

May 29, 1975

1 1/2 hrs. WOC 1 hr. Tag cement @ 222, Pull out 1 hr. Put Drlg Nipple on
& go in with Bit 1 1/2 hrs. Drlg. cement to from 222-225
1 hr. Drlg. cement from 255-275 bottom. of csg = 272 (16")
1 1/2 hr. Pull out take drlg. Nipple off go in W/DP to 275'
cement & pull out hole 2 3/4 hrs. WOC 1 1/2 hr. WOC 1 1/2 hr. Check plug
pressure up & start plug 4 hrs. WOC