

February 18, 1975

American Quasar

Midland, Texas

Attn: Drilling Dept.

RE: BOP Test - Your Huber State #1

Gentlemen:

We made a hydrostatic pressure test to captioned blowout control equipment on February 5, 1975, and February 11, 1975, and February 13, 1975, and wish to advise the following:

At the conclusion of testing:

Valve: Leak thru check valve off stack on kill line - to be repaired or replaced as needed.

Items of the blowout control equipment from top of test plug landed in casing head up through Hydril were tested to 1500# with separate tests being made at the pressure of 3000# to blind rams, pipe rams, chokeline, choke-manifold, and to the valves and fittings off the bop stack proper.

There were no visible leak to items tested at the conclusion of testing other than as mentioned above.

A delay was observed to operation of blowout control equipment at the conclusion of testing - closing lines leaked (repaired as needed) and closing lines to Hydril crossed (corrected as needed). Closures were made using closing unit pump only to the observed