

11. TIH with tubing to 100' below cut. Mix and spot 110 sk balanced cement plug to plug back to 100' above cut. [TAG]
12. PU tubing to 600'. Mix and spot a 150 sk balanced cement plug from 400' to 600'.
13. POOH. Mix and spot a 40 sk surface plug from 50' to surface.
14. Cut and cap the well. Install dry hole marker. Backfill cellar and any pits. RDMO location.
15. Remove all production equipment. Restore location as required by BLM.

AA/114