

12. POH LD tbg to 5950; spot 40 sx cmt plug 5950-5800
13. POH LD tbg to 4600; spot 40 ^{→ enough for 150' plug} sx cmt plug 4600-4450
14. POH LD tbg to 2500; spot 50 sx cmt plug 2500-2350 to cover 9-5/8 csg shoe. (TAG PLUG)
15. POH LD tbg to 600; spot 220 sx cmt plug 600-surf to cover FW sands & cover 16" csg shoe & fill 9-5/8 csg to surf.
16. Remove BOP & wellheads. (See wellhead removal procedure issued by headquarters dated June 27, 1983).
17. Install dry hole marker; Weld on marker:

North Horseshoe Bend Comm #1
Exxon Co. USA
Lease# NM 10895
660 FNL & 1980 FEL
Sec. 22, T22S, R25E
Date Plugged

18. RDMO
19. Clean location.

#) A list of materials left on location, as well as transfers for material removed from the location should be forwarded to Materials Management in Midland.

RWG
RWG
4/14/88

MAJ
MAJ
4/14/88

M C. W. Wilson
Division Operations Superintendent