

5/25/97: Mill 3525-3536'. Circ well clean. TOH, LD section mill. TIH w/under-reamer open to 9½". Under-ream 3500-3536'. Displ mud w/9# cut brine. TOH w/under-reamer. TIH w/perf sub, 8 jts 2-3/8" tbg & DP to 3637'. BJ spotted 100 sx Class-H f/3637'. TOH w/5 stds DP, rev DP clean @ 3320'. Completed TOH w/DP. WOC.

5/26/97: TIH w/6½" bit & DCs to 2708'. WOC. TIH strapping DP, tag cmt @ 3410'. Wash cmt f/3410-3425'. WOC. Drl cmt f/3425-30', cmt still soft. WOC. Drlg cmt f/3430-3505' KOP.

5/27/97: TOH, PU BHA #1. TIH to 3505', KOP. PU swivel. Run gyro. Time drl f/3505-08'. Slide drl f/3508-11'. Control drl f/3511-15'. Run gyro check shot. Svy. Slide drlg 3515-3527'. Svy. Slide drlg 3527-33'. Svy. Pull gyro, run steering tool. Pull steering tool & rehead.

5/28/97: Rehead WL. TIH w/steering tool. Slide drl f/3533-46'. Svy & connection. TIH to 3546'. Slid drl f/3546-78'. TOH w/overshot & rehead. Slide drl f/3578-94'. Svy.

5/29/97: Slide drl f/3594-3608'. Svy, TOH for lateral motor. TIH w/PDC bit & lat motor w/1.75 benthousing. Drl f/3608-3957'. TOH for GR tool - working motor thru tight spot @ 3608' - end of curve.

5/30/97: Work thru tight hole @ 3608'. Complete TOH to wet connect. TIH w/Gamma. Rehead wireline. TIH. W&R 3600-41'. Log 3606-3957'. Drl 3957-4400'.

5/31/97: Drlg f/4400-4494' Pmp soft line. Drlg 4494-4558'. Repair packoff. Drlg f/4558-5095'.

6/01/97: Drlg 5095-5157'. Change out power swivel. Drlg 5157-5501' - TD lateral. Circ well. TOH, LD DP & tools. TD lateral @ 11:30pm, 5/31/97.