

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-015-23215
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. Lease Name or Unit Agreement Name Guitar Estate Com
2. Name of Operator Hallwood Petroleum, Inc. <i>L.W. Trimmer?</i>	8. Well No. 1
3. Address of Operator P. O. Box 378111, Denver, Colorado 80237	9. Pool name or Wildcat N. Loving (Morrow)
4. Well Location Unit Letter <u>H</u> : <u>2100</u> Feet From The <u>North</u> Line and <u>710</u> Feet From The <u>East</u> Line Section <u>19</u> Township <u>23S</u> Range <u>28E</u> NMPM <u>Eddy</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3067' GL, 3083' KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	7-29-94 ENT REPORT OF:	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	<i>Note to Mike to check well when in area. JAM</i>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>			
OTHER: <input type="checkbox"/>			

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Hallwood Petroleum, Inc. proposes to Plug and Abandon the subject well as follows:

- 1) Pull out tubing & packer at 12,126'.
- 2) Set a 5" CIBP at 12,150' and cap with 35 feet of cement, covering Morrow perfs at 12,194-12,200'
- 3) Load hole with plug mud.
- 4) Set a 100' cement plug across the Penn. formation 10,636-10,736'.
- 5) Set a 310' cement plug across the Wolfcamp and the 5" liner top 9000-9310'.
- 6) Set a 100' cement plug across Bone Spring a 5860-5960'.
- 7) Cut casing (7") at 2500' set a shoe and stub plug at 2370-2500'.
- 8) Set a cement plug at 300-600'.
- 9) Set a 10 sack surface plug

Note: Wellbore diagrams attached.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *Eva Kardas* TITLE Production Technician DATE 1/20/93
TYPE OR PRINT NAME Eva Kardas (303) TELEPHONE NO. 850-6282

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: