

DATE	DEPTH	OPERATIONS
10-21	11,743'	Day 143 - PBSD 11,743' - Completing Well - (9-5/8" @ 9860') - N.D. BOP - N.U. Tree & test - Test back side to 1500 psi - Swab well to 6000' - Sand line parted - Left swab, Sinker bar & 150' sand line in hole - RIH w/ sinker bar - Did not have enough line to tag fish. Swbd F.L. to 8500' while waiting on new sand line.
10-22	11,743'	Day 144 - PBSD 11,743' - Fishing for Swab - (9-5/8" @ 9860') W.O. & Change out sand line - Swab F.L. to 11,000'. RIH w/ 3 pronged W.L. spear. Removed 1 Ft. of sand line. SDFN.
10-23	11,743'	Day 145 - PBSD 11,743' - Fishing For Swab - (9-5/8" @ 9860') Fish for sand line w/ W.L. spear - Rec 3' sand line - Total of 4' recovery.
10-24	11,743'	Day 146 - TD 11,743' - Fishing For Swab - (9-5/8" @ 9860') - RIH w/ W.L. spear & rec 152' Sand line. RIH w/ 2 1/4" O.S. w/ 1-3/4" Grapple. POOH - No recovery. SDFN.
10-25	11,743'	Day 147 - PBSD 11,743' - Fishing For Swab - (9-5/8" @ 9860') RIH w/ O.S. w/ cutrite guide - No Recovery. Run W.L. spear - No recovery. Run magnet & rec small amount of paraffin & sand line core - Run box tap w/ no rec. Run impression block - Indicated some sand line still on top of swab. Run W.L. Spear no rec. Run O.S. - No rec.
10-26	11,743'	Day 148 - PBSD 11,743' - S.I. - Swab Well To Top Of Fish & Rec Paraffin & Pipe Scale. RIH w/ O.S. w/ no rec. RIH w/ box tap - Tap covered w/ paraffin. RIH w/ swab & agitate on top of fish. Replace sand line shoe. RIH w/ O.S. w/ no rec.
10-27	11,743'	Day 149 - PBSD 11,743' - N.D. Tree - S.D.F.S. Prep to pull tbg & fish for swab sinker bar.
10-28	11,743'	Day 150 - PBSD 11,743' - Completing Well - (9-5/8" @ 9860') - N.D. Tree - Attempt to work on/off tool or un-"J" Assembly w/o success. W.O. Dialog.
10-29	11,743'	Day 151 - PBSD 11,743' - Completing Well - (9-5/8" @ 9860') - R.U. Dialog - RIH w/ string shot - Couldn't release on/off tool. Worked tbg attempting to un-jay seal assembly. RIH w/ chemical cutter & cut tbf off @ 11,510'. Started POOH w/ tbg - SDON.
10-30	11,743'	Day 152 - PBSD 11,743' - Completing Well (9-5/8" @ 9860') - POOH - P.U. shoe, 1 jt 6" W.P. & 4 - 4-3/4" DC's - RIH - SDON.
10-31	11,743'	Day 153 - PBSD 11,743' - Milling Over Pkr - (9-5/8" @ 9860') RIH & washed over on/off tool. Circ up large amount of pipe scale.
11-1	11,743'	Day 154 - PBSD 11,743' - Completing Well - (9-5/8" @ 9860') Cut 6" over pkr. POOH - Pin broke off in change over sub leaving W.P. & shoe in hole. SDON.
11-2	11,743'	Day 155 - PBSD 11,743' - Completing Well - RIH w/ shoe - Mill over 3' - Circ hole clean - SDFN.
11-3	11,743'	Day 156 - PBSD 11,743' - Milling up shoe - SIFS.
11-4	11,743'	Day 157 - PBSD 11,743' - RIH w/Shoe - (9-5/8" @ 9860') - Mill on 6" shoe & made 18" - Circ hole clean - POOH - Rec piece of shoe 6" long in W.P. SDFN.
11-5	11,743'	Day 158 - PBSD 11,743' - POOH - (9-5/8" @ 9860') - RIH - Mill on junk & made 3" - Circ hole clean & POOH.